

General Information

Date & Time: 11, May, 2026 17:36

Make	Nissan	Model	NV350
YOM	2019	Odo Meter Reading	106,968
Registration No.	NEJ6122	Chassis No.	JNTC2E26Z0055561
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



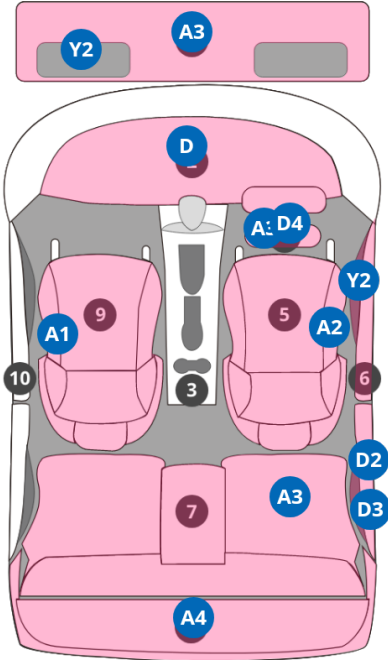
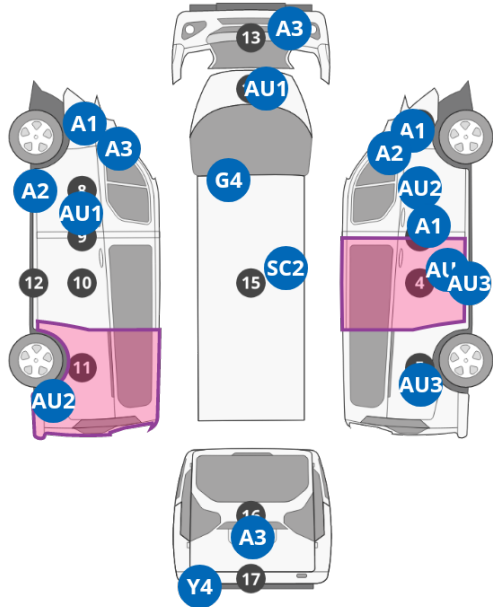
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	203.3	210	182	218
2	Boot Lid	155.6	109	242	116
3	Roof	117.7	97	87	121/166
4	Left Front Fender	360.3	307	218	556
5	Left Front Door	145.3	153	142	141
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	181.3	130	168	246
9	Right Front Fender	166.3	161	164	174
10	Right Front Door	404.3	160	174	879
11	Center Panel Right	156.0	173	145	150
12	Right Rear Door	382.6	146	231	771
13	Right Back Panel	257.6	130	135	508

Overall Evaluation :

E

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / Ceiling - Cut, Crack - Medium / (R) Front Trim - Grime - Small / (R) Front Seat - Cut, Crack - Small / (R) Rear Trim - Loose, Deformed - Small / Rear Seat - Cut, Crack - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Large / Mat Other - Cut, Crack - Medium / Carpet - Worked - Large / (L) Front Seat - Cut, Crack - Minimal / Dashboard - Traces of Adhesive Tape - Yes / Sunvisor, Sunglass Holder - Grime - Small / Trim Other - Loose, Deformed - Medium	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / Front Panel - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Center Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Center Panel - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / Roof - Rust, Corrosion - Small / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Crack, Gap - Large / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Mirror - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Panel - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Front Windshield - Scratch, Stone chip - Large / (R) Rear Door, Molding - Repair mark - Yes
Frame Evaluation : B	Functional Evaluation : D
Remarks Front Floor and Side Member - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Warning Lamps - Issue - Yes / Air Conditioner - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire, 1key, no warranty booklet, no jack and tools, scratches on headlights and taillights, aircon issue, airbag warning lamp on,