

General Information

Date & Time: 04, May, 2026 15:44

Make	Mitsubishi	Model	Mirage
YOM	2024	Odo Meter Reading	18,866
Registration No.	HAH3196	Chassis No.	PAEA13RXRRA018886
CC	1.2	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Gray		

Body / Panel Condition



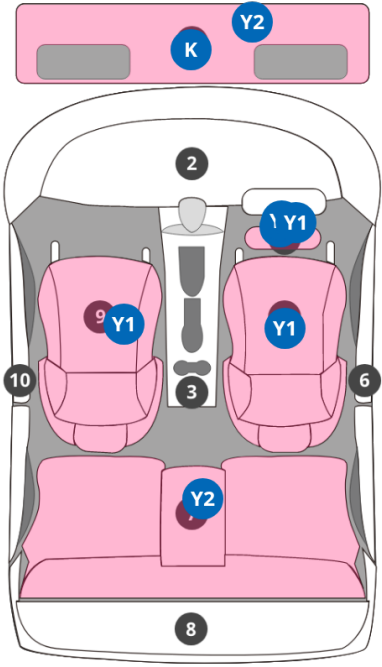
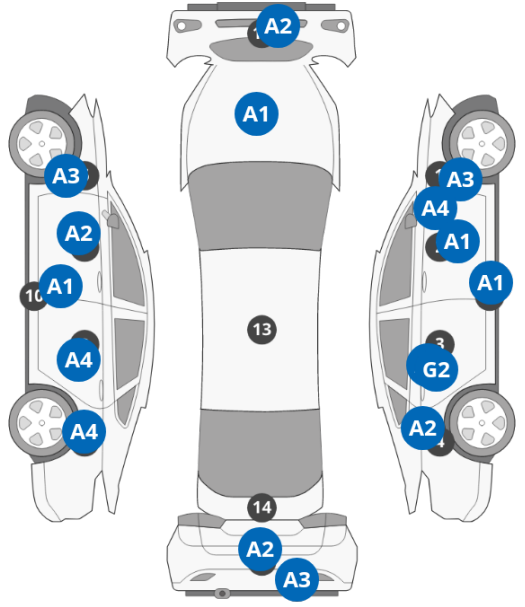
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	128.6	137	128	121
2	Boot Lid	106.6	101	107	112
3	Roof	109.2	99	113	111/114
4	Left Front Fender	118.3	135	112	108
5	Left Front Door	122.3	115	119	133
6	Center Panel Left				
7	Left Rear Door	110.3	113	112	106
8	Left Back Panel	131.0	125	134	134
9	Right Front Fender	115.3	109	118	119
10	Right Front Door	119.6	115	122	122
11	Center Panel Right				
12	Right Rear Door	107.3	109	105	108
13	Right Back Panel	117.6	120	115	118

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Animal Hair - Yes / Ceiling - Grime - Small / (R) Front Floor Mat - Grime - Minimal / (L) Front Floor Mat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / Rear Seat - Grime - Small / Mat Other - Grime - Minimal	Remarks (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Large / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Large / (R) Side Window - Scratch, Stone chip - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Mirror - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
Small scratch at Right rear window. Visible hairline scratches. Seatcover detached. Incomplete tools. Without warranty booklet. With jack, LTO PLate and 1key.