

General Information

Date & Time: 04, May, 2026 15:15

Make	Nissan	Model	Navara
YOM	2018	Odo Meter Reading	65,716
Registration No.	GAM8000	Chassis No.	MNTCC4D23Z0039321
CC	2.5	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Silver		

Body / Panel Condition



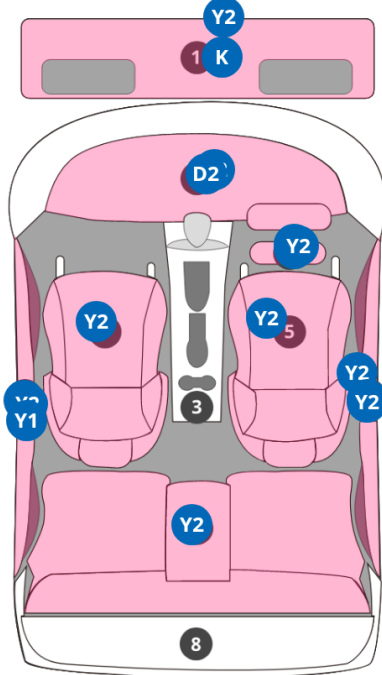
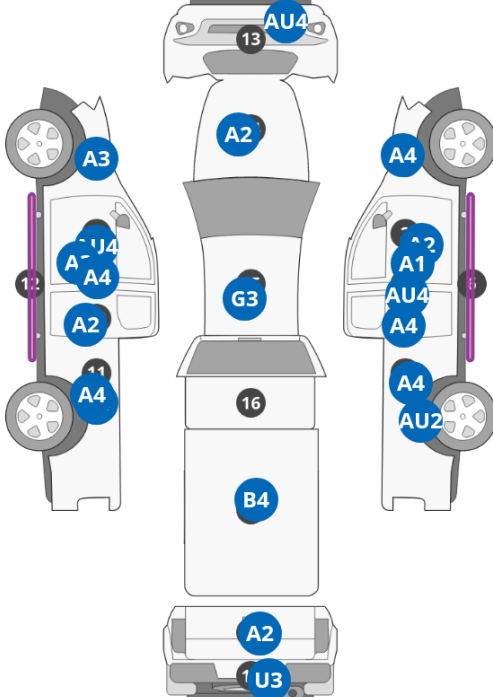
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.8	100	117	128
2	Boot Lid	108.0	106	106	112
3	Roof	107.2	103	102	123/101
4	Left Front Fender	121.0	128	118	117
5	Left Front Door	97.5	96	99	97
6	Center Panel Left	118.1	100	155	100
7	Left Rear Door	99.4	109	96	94
8	Left Back Panel	115.3	126	108	112
9	Right Front Fender	108.3	111	110	104
10	Right Front Door	106.2	101	94	124
11	Center Panel Right	78.6	83	76	77
12	Right Rear Door	152.3	157	172	128
13	Right Back Panel	215.3	205	225	216

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / Overall Interior - Animal Hair - Yes / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Small / Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / Mat Other - Grime - Small / (R) Front Trim - Grime - Small / Trim Other - Grime - Minimal / (R) Rear Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Rear Trim - Grime - Small / Trim Other - Grime - Minimal / (L) Front Seat - Grime - Small / Steering Wheel - Worn, Peel, Crack - Small / Glove Box - Loose, Deformed - Small	Remarks Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Large / Front Windshield - Scratch, Stone chip - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Partially Missing - Yes / (L) Step, In-panel, Side Spoiler - Partially Missing - Yes / (R) Mirror - Scratch - Minimal / (R) Guard Frame - Scratch - Large / (R) Side Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Dent - Medium / Rear Gate - Scratch - Small / Roof - Modified - Large / (L) Side Gate - Scratch - Large / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Guard Frame - Scratch - Large / (L) Front Door, Molding - Scratch - Large / (L) Front Fender, Molding - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
Possible flooded. Scratches and gap at frontbumper. Visible hairline scratches. Repainted at right rear door. Trunk rear gate hard to open. Front hood hard to open. Left brake light busted. Crack at both sides rear lights. Incomplete tools. Without jack, Seatcover. With warranty booklet, LTO plate and 1key.