


General Information

Date & Time: 04, May, 2026 14:09

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	92,063
Registration No.	NHR4217	Chassis No.	PA1B18F34P4229066
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition

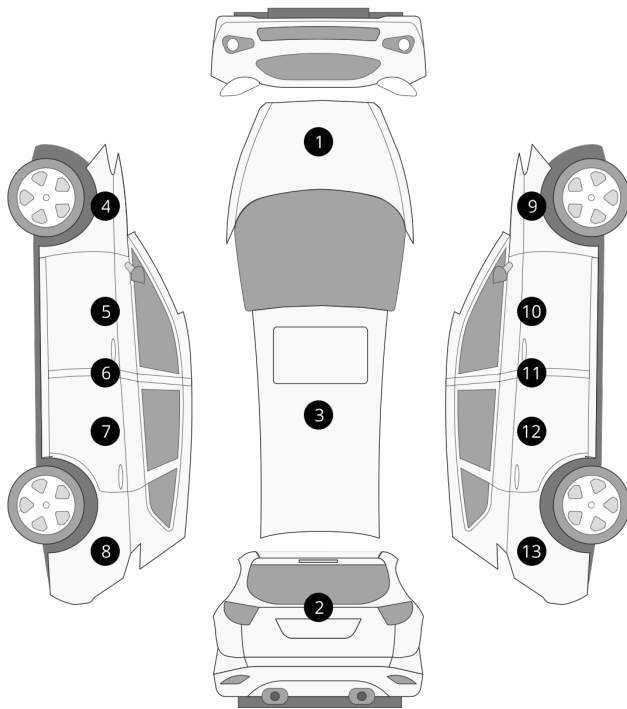

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.3	126	119	110
2	Boot Lid	131.3	131	123	140
3	Roof	106.7	113	106	102/106
4	Left Front Fender	113.3	112	110	118
5	Left Front Door	115.6	107	108	132
6	Center Panel Left				
7	Left Rear Door	127.6	139	120	124
8	Left Back Panel	122.3	129	119	119
9	Right Front Fender	109.3	105	115	108
10	Right Front Door	110.3	113	106	112
11	Center Panel Right				
12	Right Rear Door	113.3	104	111	125
13	Right Back Panel	111.3	114	109	111

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Sunvisor, Sunglass Holder - Grime - Medium / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Cut, Crack - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Dent - Minimal / (L) Mirror - Crack - Damaged / (L) Front Fender, Molding - Scratch & Dent - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Dent - Minimal / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
With Lto plate, with spare tire, with jack and tools, 2keys, no warranty booklet, scratches on headlights and taillights,