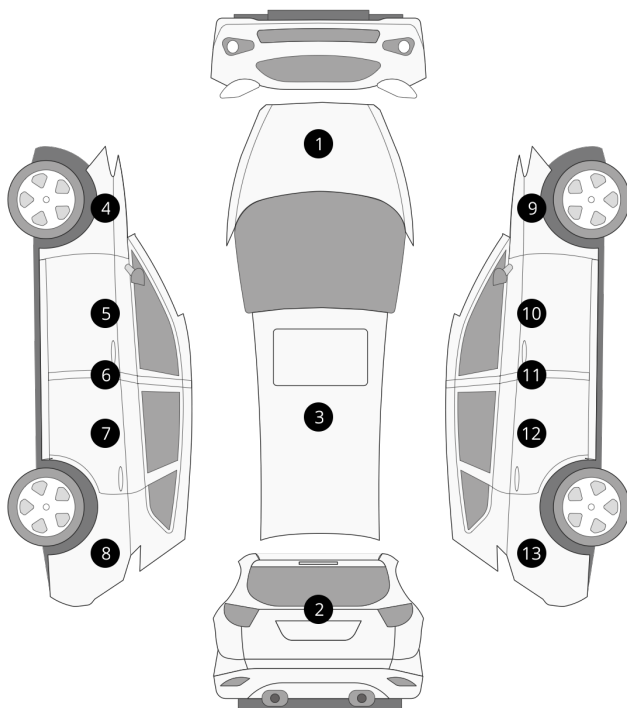


General Information

Date & Time: 04, May, 2026 14:05

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	76,655
Registration No.	NFE4181	Chassis No.	PA1B18F36N4181194
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



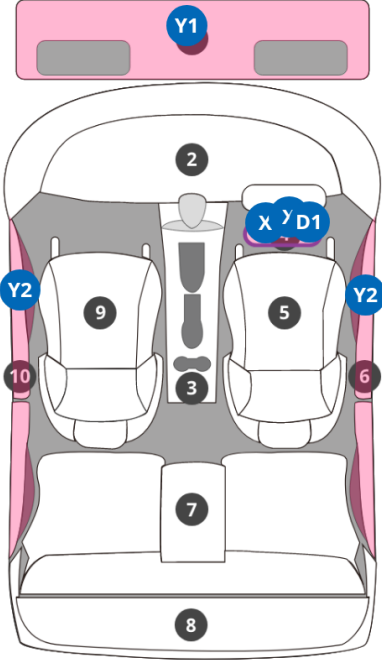
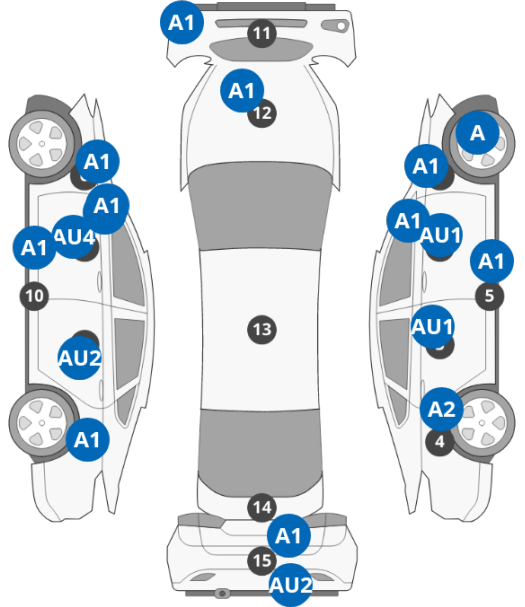
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.6	118	105	118
2	Boot Lid	120.0	122	117	121
3	Roof	97.9	102	99	96/95
4	Left Front Fender	102.6	104	102	102
5	Left Front Door	108.6	108	109	109
6	Center Panel Left				
7	Left Rear Door	109.3	112	106	110
8	Left Back Panel	117.6	125	117	111
9	Right Front Fender	101.2	108	100	96
10	Right Front Door	107.0	98	106	117
11	Center Panel Right				
12	Right Rear Door	105.0	106	101	108
13	Right Back Panel	105.1	99	104	112

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / Carpet - Worked - Minimal	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Mirror - Crack - Damaged / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / (R) Front Tyre - Crack, Cut - Yes
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes

Inspector Notes
With Lto plate, with spare tire and jack, with warranty booklet, 2keys, no tools, scratches on headlights and taillights,