

General Information

Date & Time: 04, May, 2026 17:11

Make	Toyota	Model	Vios
YOM	2020	Odo Meter Reading	77,921
Registration No.	DAZ1608	Chassis No.	PA1B18F3XK4107830
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



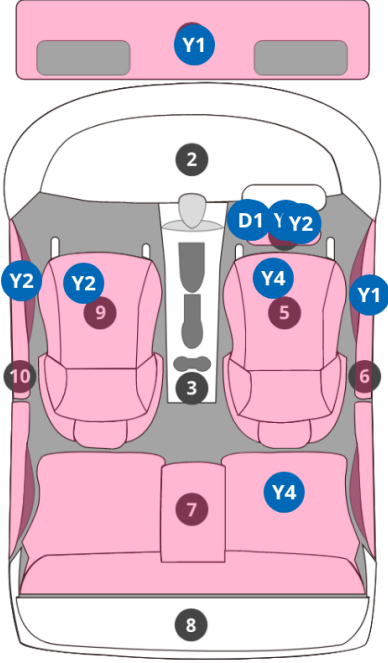
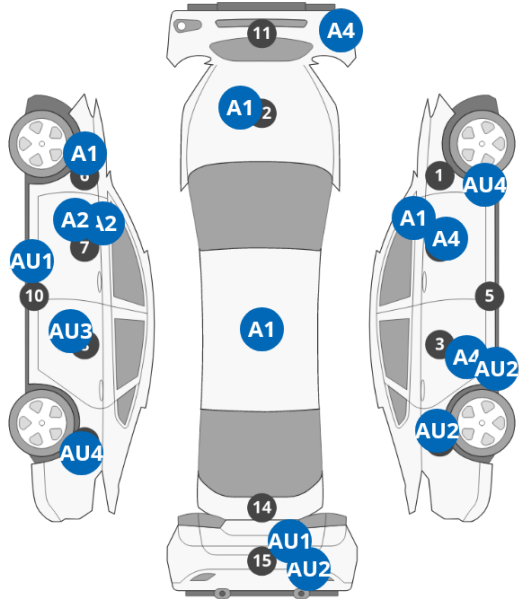
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	114	110	111
2	Boot Lid	112.6	112	102	124
3	Roof	89.4	101	78	94/84
4	Left Front Fender	97.8	101	93	100
5	Left Front Door	93.9	100	87	94
6	Center Panel Left				
7	Left Rear Door	97.5	96	102	94
8	Left Back Panel	105.6	108	105	104
9	Right Front Fender	96.3	91	99	99
10	Right Front Door	100.6	101	101	100
11	Center Panel Right				
12	Right Rear Door	95.0	92	95	97
13	Right Back Panel	99.2	100	98	100

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / Rear Seat - Grime - Large / Mat Other - Grime - Small / (R) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Large / (R) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Cut, Crack - Small / Carpet - Worked - Minimal	Remarks (R) Front Fender, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Small / Roof - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire, 1key, no warranty booklet, no jack and tools, scratches on headlights and taillights,