


General Information

Date & Time: 04, May, 2026 19:18

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	119,311
Registration No.	CCA1904	Chassis No.	PA1B18F33P4220780
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition

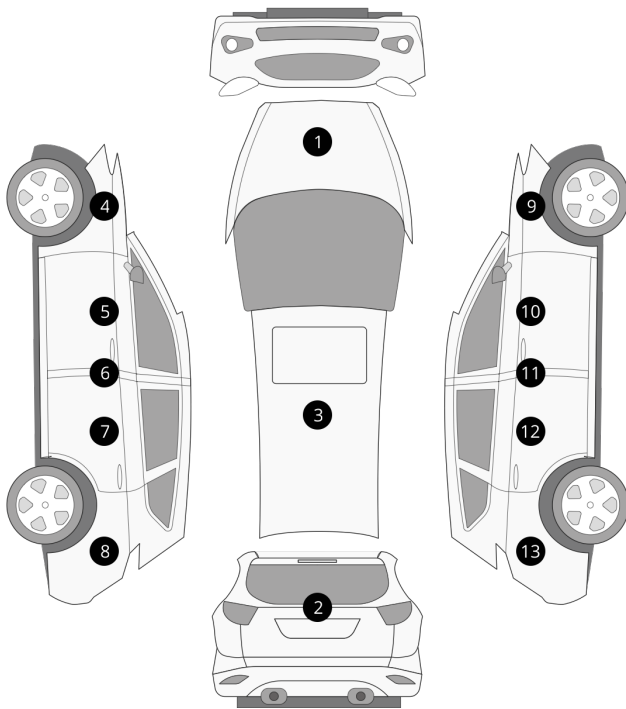

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.3	125	117	110
2	Boot Lid	130.3	131	122	138
3	Roof	101.3	106	100	99/101
4	Left Front Fender	111.6	110	113	112
5	Left Front Door	114.3	119	106	118
6	Center Panel Left				
7	Left Rear Door	118.0	117	118	119
8	Left Back Panel	116.3	123	112	114
9	Right Front Fender	111.0	108	113	112
10	Right Front Door	112.3	110	117	110
11	Center Panel Right				
12	Right Rear Door	109.0	106	112	109
13	Right Back Panel	112.6	103	106	129

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Rear Seat - Grime - Large / (L) Rear Trim - Cut, Crack - Minimal / (L) Front Trim - Grime - Large / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Small / Carpet - Worked - Minimal	Remarks (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch & Dent - Minimal / Roof Spoiler, Molding - Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

No Rear Lto plate,with warranty booklet and spare tire, 1key, no jack and tools, scratches on headlights and taillights, plate light issue,