

General Information

Date & Time: 05, May, 2026 15:28

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	115,936
Registration No.	FAO8961	Chassis No.	PA1B18F39P4220797
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



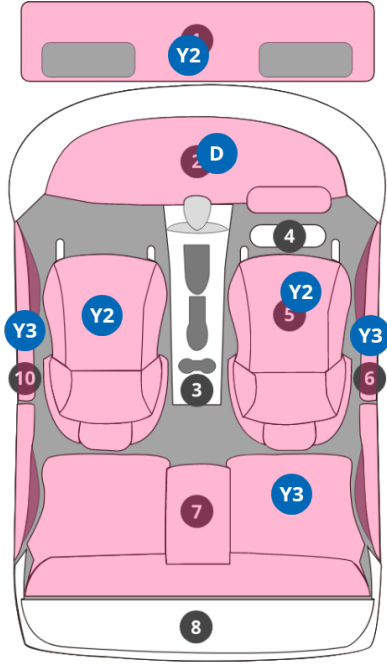
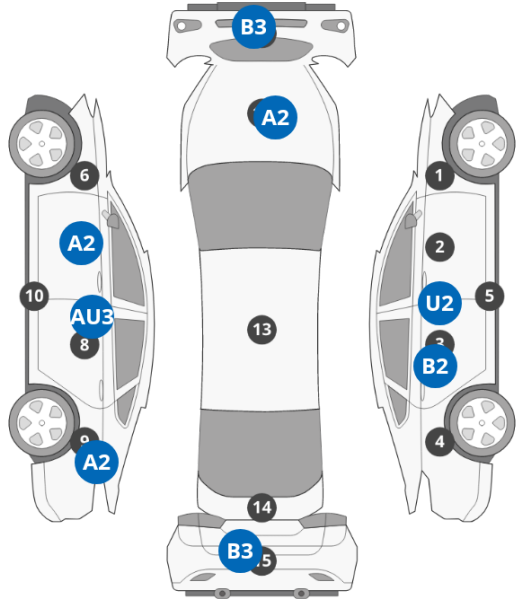
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	292.0	289	291	296
2	Boot Lid	104.0	101	104	107
3	Roof	181.7	188	180	183/176
4	Left Front Fender	92.7	94	91	93
5	Left Front Door	94.7	93	92	99
6	Center Panel Left				
7	Left Rear Door	100.7	115	92	95
8	Left Back Panel	102.3	102	104	101
9	Right Front Fender	95.4	96	95	95
10	Right Front Door	94.7	100	89	96
11	Center Panel Right				
12	Right Rear Door	101.5	89	100	116
13	Right Back Panel	90.6	92	87	93

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small	Remarks (R) Step - Repair Traces - Yes / Bonnet - Repair Traces - Yes / Roof - Repair Traces - Yes / Trunk Hood, Rear Gate - Modified - Medium / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Small / (R) Front Door, Molding - Dent - Small / (R) Rear Door, Molding - Modified - Small / Front Bumper, Grille, Lamps - Modified - Medium / Bonnet, Headlight - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

Modified muffler, Missing headlight, park light, and signal light in front. Repainted hood and roof, no spare tire. no spare key, with seat cover, no warranty booklet. no jack and tools