

General Information

Date & Time: 08, May, 2026 15:41

Make	Mitsubishi	Model	Mirage
YOM	2026	Odo Meter Reading	5,533
Registration No.	NKT9034	Chassis No.	PAEA13RJTSA012163
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



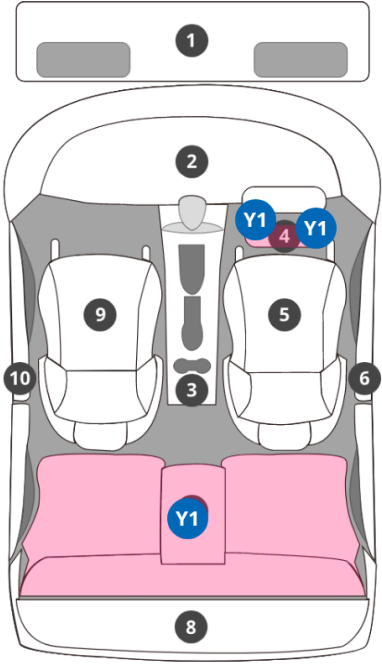
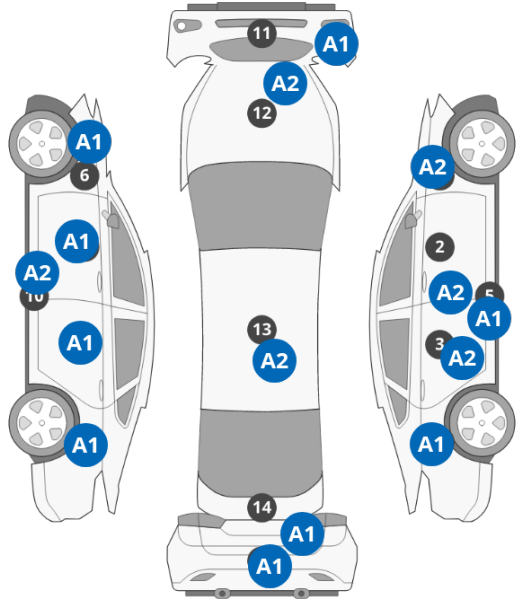
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	131.3	138	126	130
2	Boot Lid	106.5	100	121	99
3	Roof	102.8	99	104	103/105
4	Left Front Fender	112.0	112	102	122
5	Left Front Door	118.3	116	118	121
6	Center Panel Left				
7	Left Rear Door	113.0	116	110	113
8	Left Back Panel	126.0	127	128	123
9	Right Front Fender	112.0	125	101	110
10	Right Front Door	113.3	114	112	114
11	Center Panel Right				
12	Right Rear Door	111.0	112	108	113
13	Right Back Panel	117.6	117	111	125

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Minimal / (R) Front Floor Mat - Grime - Minimal / (L) Front Floor Mat - Grime - Minimal	Remarks (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes

no LTO plate/no warranty booklet/no tools with jack/with spare tire/hairline scratches on the body/maintenance warning lamp on