

General Information

Date & Time: 08, May, 2026 15:42

Make	Suzuki	Model	Carry
YOM	2025	Odo Meter Reading	4,019
Registration No.	MBD7205	Chassis No.	MHYDC61T4SJ270605
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Van
Colour	White		

Body / Panel Condition



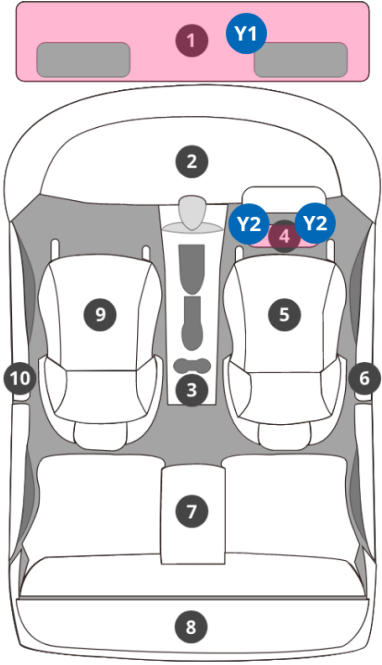
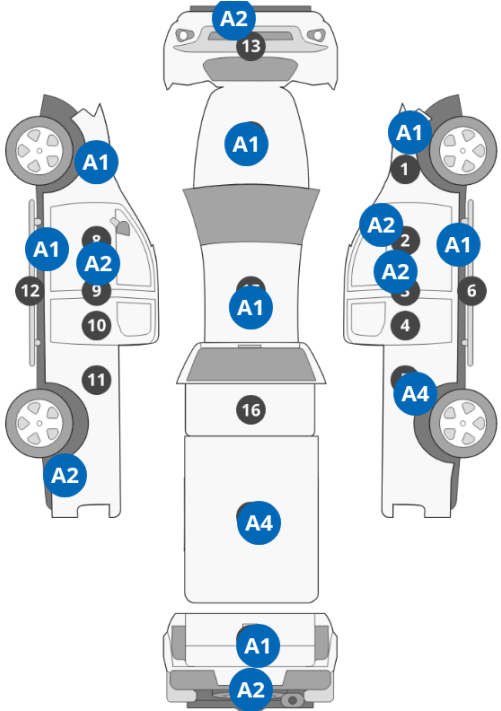
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.6	121	108	109
2	Boot Lid	111.6	122	112	101
3	Roof	96.6	103	106	89/89
4	Left Front Fender	117.3	117	116	119
5	Left Front Door	98.7	85	108	103
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	138.3	133	142	140
9	Right Front Fender	120.3	116	125	120
10	Right Front Door	101.1	101	111	91
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	123.0	129	118	122

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Small / Ceiling - Grime - Minimal	Remarks (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Side Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Rear Gate - Scratch - Minimal / Cargo Bed Floor - Scratch - Large / (R) Side Gate - Scratch - Large / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Front Panel - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes

with LTO plate/with warranty booklet/incomplete tools and jack/with spare tire/hairline scratches on the body