

General Information

Date & Time: 09, May, 2026 11:09

Make	MG	Model	HS
YOM	2022	Odo Meter Reading	29,395
Registration No.	NID7292	Chassis No.	LSJA24U97NN061823
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Blue		

Body / Panel Condition



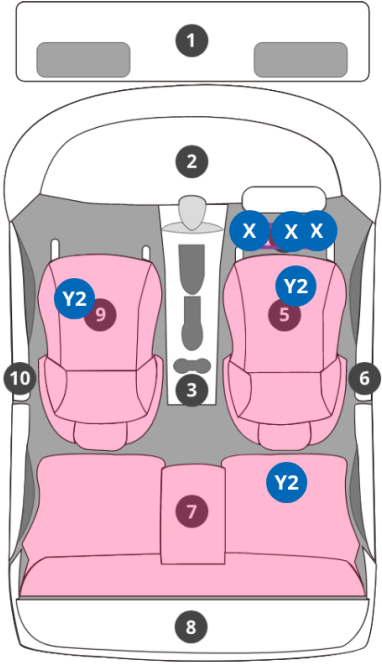
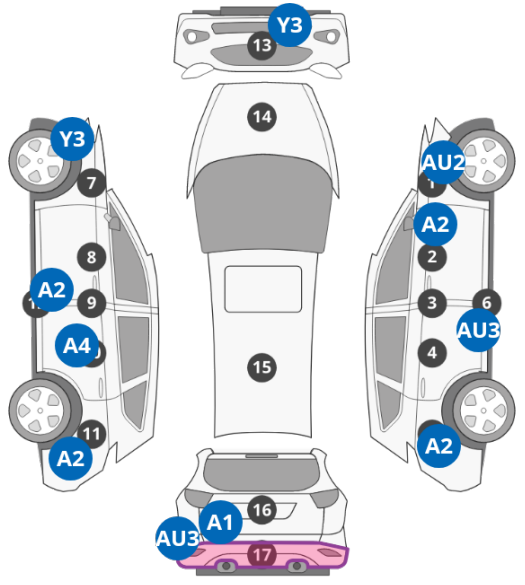
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	147.0	145	141	155
2	Boot Lid	139.0	139	144	134
3	Roof	140.0	141	136	146/137
4	Left Front Fender	144.3	147	143	143
5	Left Front Door	150.0	158	149	143
6	Center Panel Left				
7	Left Rear Door	143.6	146	148	137
8	Left Back Panel	168.0	150	184	170
9	Right Front Fender	138.6	140	137	139
10	Right Front Door	150.0	141	146	163
11	Center Panel Right				
12	Right Rear Door	146.6	164	137	139
13	Right Back Panel	159.6	152	172	155

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Rear Seat - Grime - Small	Remarks (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Crack, Gap - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Medium / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Repair mark - Yes
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes

Battery for replacement. Crack left taillight. With warranty booklet and spare tire. Without jack and tools. 2 keys. With LTO plate.