

General Information

Date & Time: 18, Feb, 2025 10:13

Make	Toyota	Model	Vios
YOM	2024	Mileage	10,797
Registration No.	NIQ8122	Chassis No.	PA1B18F39P4232139
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



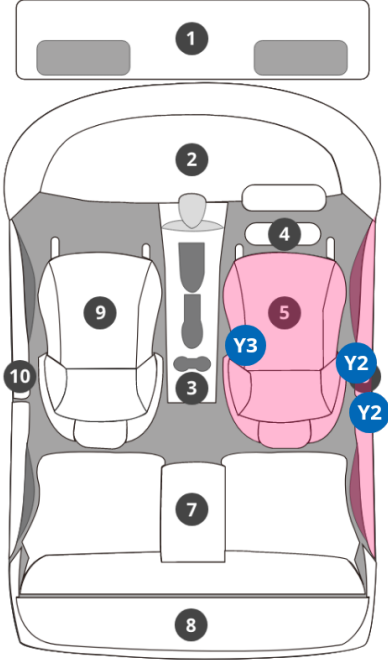
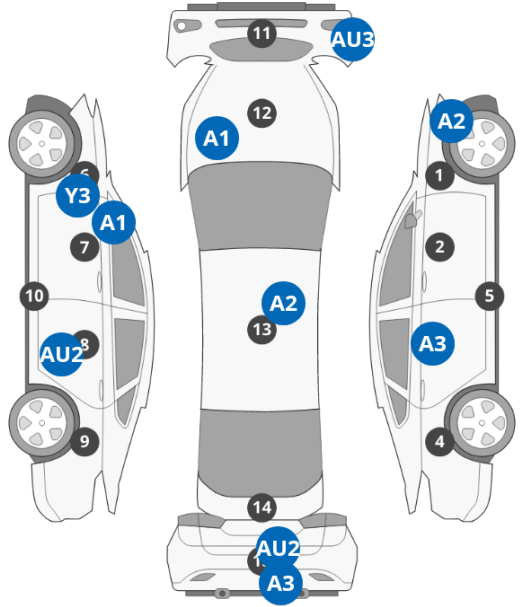
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.9	100	100	100
2	Boot Lid	102.0	95	103	108
3	Roof	103.0	108	102	97/105
4	Left Front Fender	188.6	176	191	199
5	Left Front Door	279.0	476	190	171
6	Center Panel Left				
7	Left Rear Door	240.3	132	463	126
8	Left Back Panel	99.8	108	98	93
9	Right Front Fender	106.2	112	100	107
10	Right Front Door	193.3	266	166	148
11	Center Panel Right				
12	Right Rear Door	474.3	810	249	364
13	Right Back Panel	101.8	99	98	109

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Rear Trim - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Front Door, Molding - Crack, Gap - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, no jack, no tools, no spare tire, with LTO plate, trace of adhesive mark on front windshield, retractable mirror issue, turn light/hazard light issue, radio control on steering wheel, issue