

General Information

Date & Time: 13, May, 2026 08:05

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	16,445
Registration No.	NJF1924	Chassis No.	PA1B18F39R4277066
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



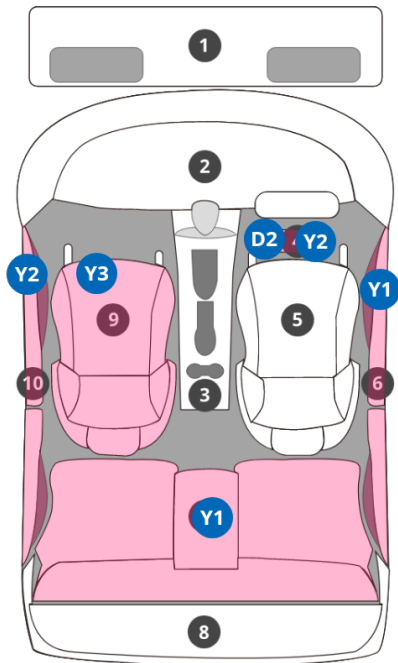
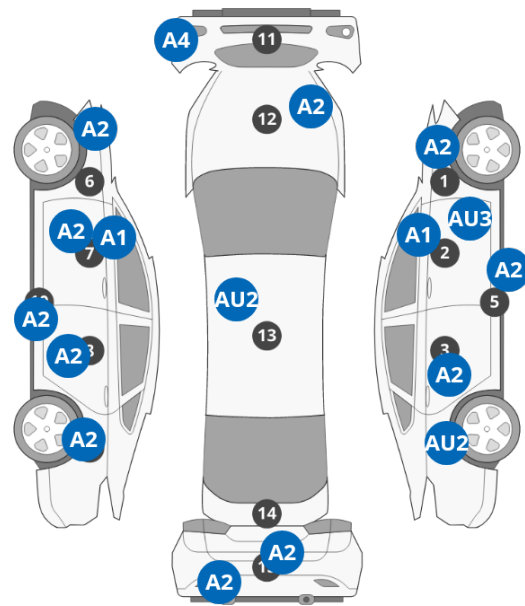
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.3	106	101	109
2	Boot Lid	104.0	101	100	111
3	Roof	96.3	94	105	84/102
4	Left Front Fender	100.0	102	98	100
5	Left Front Door	91.2	87	93	94
6	Center Panel Left				
7	Left Rear Door	102.8	101	110	98
8	Left Back Panel	115.3	125	109	112
9	Right Front Fender	105.3	105	100	111
10	Right Front Door	102.5	111	97	100
11	Center Panel Right				
12	Right Rear Door	105.0	99	98	119
13	Right Back Panel	111.0	110	104	119

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Grime - Small / (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : D
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate/with warranty booklet/no tools and jack/no spare tire/aircon issue/traction control indicator on/abs light on/seat belt issue/tailight issue/tailight cover issue/horn issue/dashboard undercover missing/ hairline scratches on the body/wiper blade issue