

General Information

Date & Time: 09, May, 2026 08:55

Make	Mitsubishi	Model	Mirage
YOM	2025	Odo Meter Reading	2,320
Registration No.	NJQ3469	Chassis No.	PAEA13MJSSA000870
CC	1.2	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Gray		

Body / Panel Condition



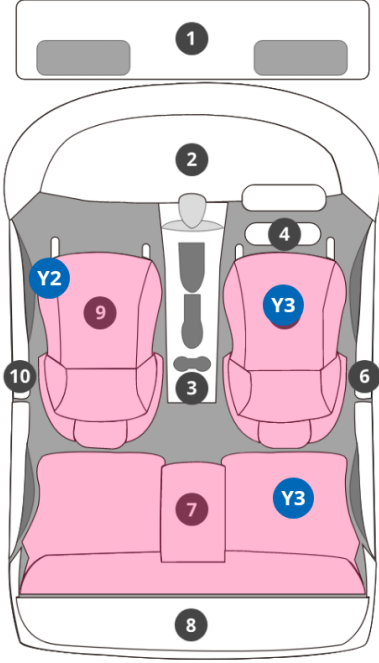
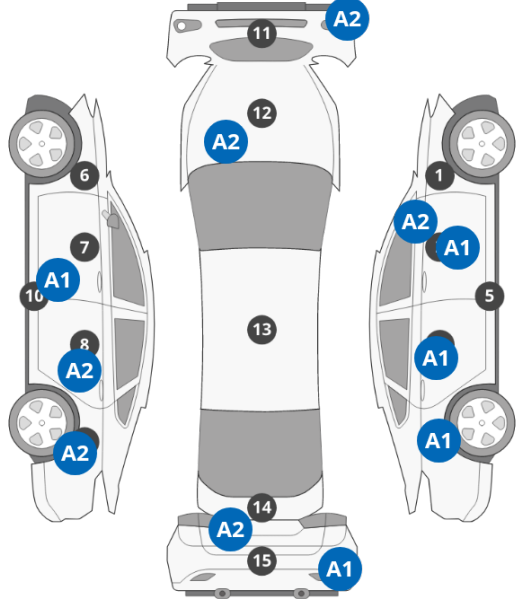
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	123.3	129	131	110
2	Boot Lid	107.6	102	116	105
3	Roof	98.6	83	100	105/107
4	Left Front Fender	105.3	109	107	100
5	Left Front Door	108.3	112	105	108
6	Center Panel Left				
7	Left Rear Door	103.1	107	103	99
8	Left Back Panel	113.3	111	117	112
9	Right Front Fender	107.6	101	106	116
10	Right Front Door	112.6	115	112	111
11	Center Panel Right				
12	Right Rear Door	110.6	107	107	118
13	Right Back Panel	108.0	106	106	112

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Small	Remarks (R) Mirror - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
Maintenance warning lamp on. With warranty booklet, spare tire and jack. Without tools. 1 key. With LTO plate.