

General Information

Date & Time: 09, May, 2026 13:35

Make	MG	Model	G50
YOM	2024	Odo Meter Reading	30,884
Registration No.	FAS7374	Chassis No.	LSKK4BC10RD057201
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	MPV
Colour	Silver		

Body / Panel Condition



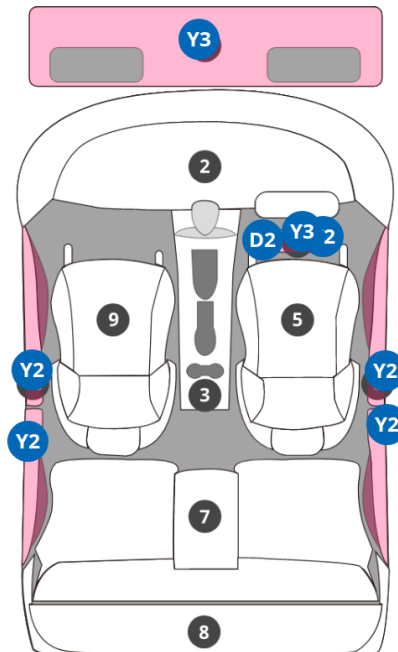
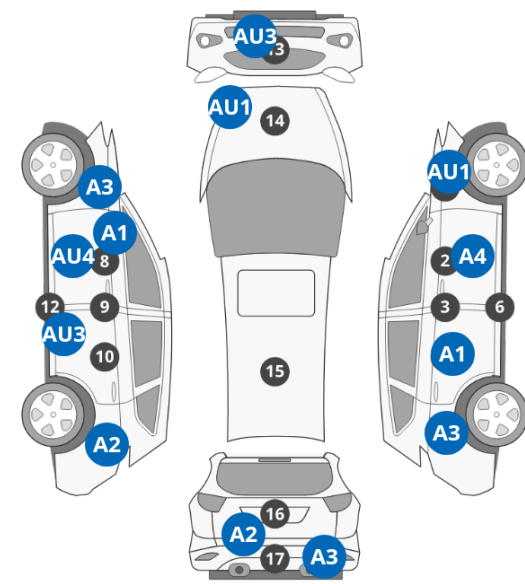
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	148.3	143	165	137
2	Boot Lid	111.6	105	120	110
3	Roof	144.5	137	141	156/144
4	Left Front Fender	119.0	117	114	126
5	Left Front Door	136.0	134	138	136
6	Center Panel Left				
7	Left Rear Door	132.0	139	130	127
8	Left Back Panel	122.3	129	113	125
9	Right Front Fender	128.3	138	132	115
10	Right Front Door	131.3	132	129	133
11	Center Panel Right				
12	Right Rear Door	123.3	117	125	128
13	Right Back Panel	127.6	128	114	141

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Small / Trim Other - Grime - Small / (L) Rear Trim - Grime - Small / Mat Other - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small	Remarks (L) Front Door, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Large / (R) Front Fender, Molding - Scratch & Dent - Minimal / Bonnet, Headlight - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

Gap at left front door and bonnet. With warranty booklet, spare tire, jack and seat cover. Without tools. 1 key. With LTO plate.