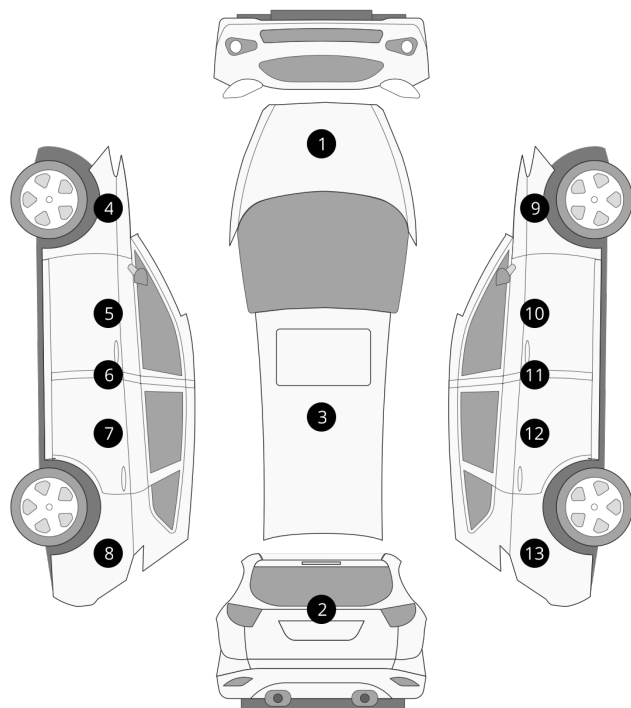


General Information

Date & Time: 18, Feb, 2025 19:30

Make	Toyota	Model	Wigo
YOM	2023	Mileage	8,548
Registration No.	NGC3195	Chassis No.	MHKA4DE5FNJ017672
CC	1.0	Transmission	M/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Silver		

Body / Panel Condition



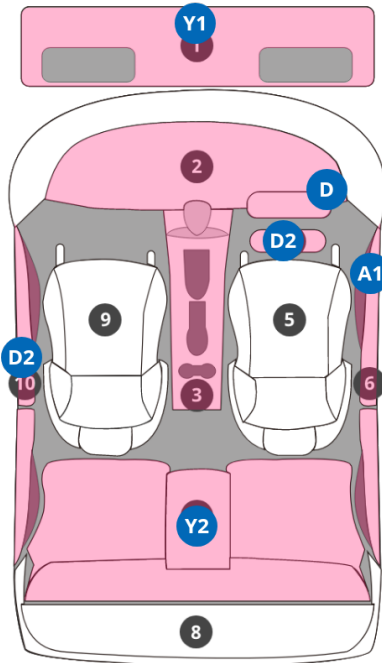
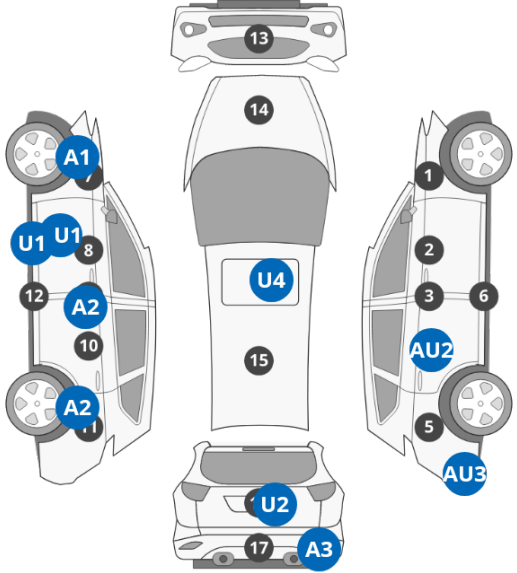
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	246.0	333	200	205
2	Boot Lid	90.7	92	92	89
3	Roof	91.4	86	94	96/91
4	Left Front Fender	83.1	78	92	80
5	Left Front Door	83.7	83	84	85
6	Center Panel Left				
7	Left Rear Door	76.1	77	72	79
8	Left Back Panel	90.3	103	81	87
9	Right Front Fender	244.0	287	205	240
10	Right Front Door	176.0	179	164	185
11	Center Panel Right				
12	Right Rear Door	106.0	97	108	113
13	Right Back Panel	89.8	98	86	85

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Cut, Crack - Minimal / Rear Seat - Grime - Small / Dashboard - Repair Mark - Yes / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small / Ceiling - Grime - Minimal / Room Mirror - Missing - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Dent - Minimal / Roof - Dent - Large
Frame Evaluation : D	Functional Evaluation : A
Remarks Right Front Pillar - Condition of Welding ? - Yes	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

with warranty booklet, no jack, no tools, with spare tire, with LTO plate, left tail light crack, inside rear view mirror missing