

General Information

Date & Time: 05, Jun, 2026 14:34

Make	Mitsubishi	Model	Montero SPT
YOM	2012	Odo Meter Reading	1,234
Registration No.	UCI206	Chassis No.	MMBGRKG40CF922329
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Black		

Body / Panel Condition



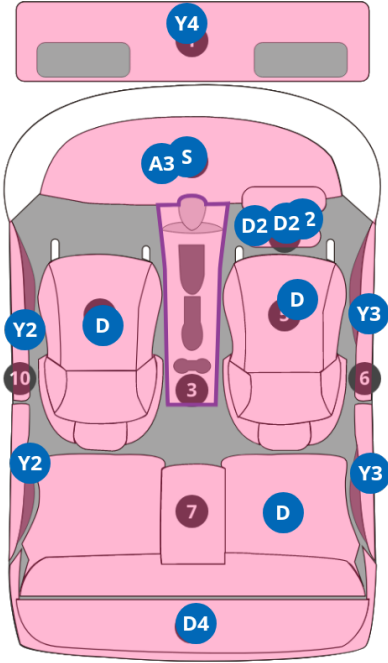
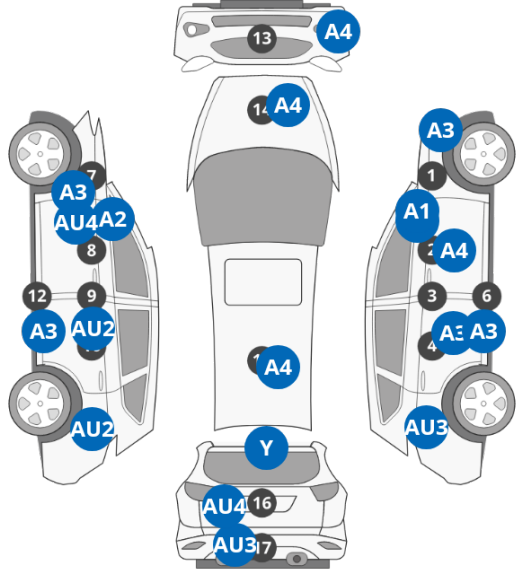
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	86.3	85	87	88
2	Boot Lid	215.0	252	187	206
3	Roof	82.2	83	80	119/47
4	Left Front Fender	87.3	86	89	87
5	Left Front Door	117.3	104	116	132
6	Center Panel Left				
7	Left Rear Door	112.3	108	115	114
8	Left Back Panel	97.7	106	92	95
9	Right Front Fender	95.9	97	98	92
10	Right Front Door	122.3	123	120	124
11	Center Panel Right				
12	Right Rear Door	128.6	121	152	113
13	Right Back Panel	85.9	82	88	89

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / Trunk Room - Loose, Deformed - Large / Rear Seat - Worn - Yes / (R) Front Seat - Worn - Yes / (L) Front Seat - Worn - Yes / Display, Audio System - Partially Missing - Yes / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Medium / (R) Rear Trim - Grime - Medium / (L) Rear Trim - Grime - Small / Ceiling - Grime - Large / Dashboard - Worn, Scratch, Cut, Crack - Medium / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / Mat Other - Worked - Small	Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Faded(Color, Gloss) - Yes / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / Overall Exterior - Worn as per age - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Large / Antennae - Damaged - Yes / Roof - Scratch - Large
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Sun Roof - Stuck, Gap - Yes / Power Seat - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Power Steering Pump - Leak - Yes / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Remote Key & Smart entry - Issue - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Parking Brake - Function - Weak / Brake Pedal - Function - Weak / Turn Signal, Hazard Flasher - Issue - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
towed unit, mileage cant verify due to panel meter issue, functional can't verify due to non moving unit, no battery, with spare tire, spare key issue, no jack and tools, possible flooding, rear wiper arm missing, antenna missing, console, switch, vent partially missing, suncrack and yellowish headlight and tail light, carpet on trunk room missing, rear door issue, rear seat issue