

General Information

Date & Time: 19, Feb, 2025 19:10

Make	Toyota	Model	Vios
YOM	2024	Mileage	29,466
Registration No.	CAZ7948	Chassis No.	PA1B18F30P4235124
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



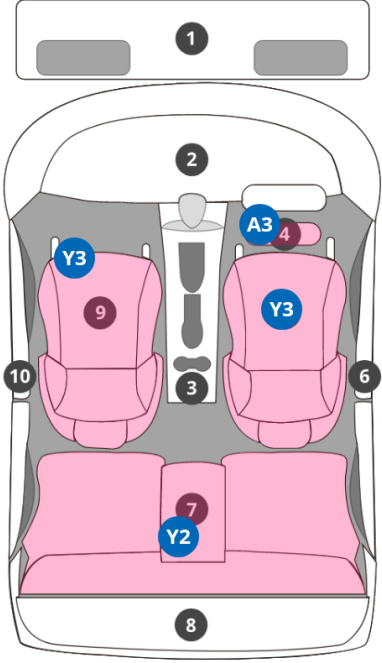
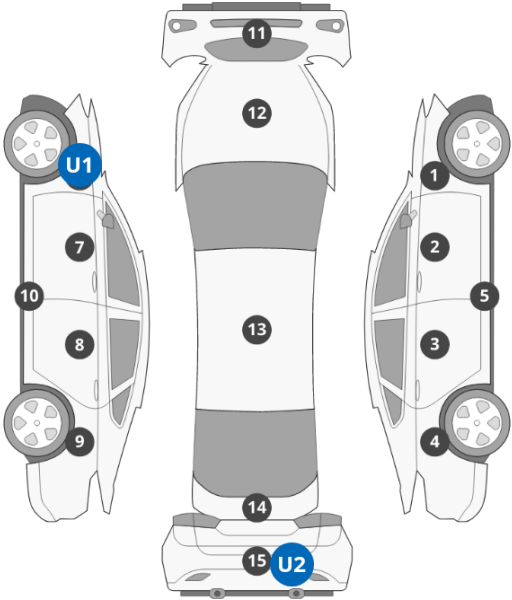
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.7	99	96	102
2	Boot Lid	99.3	101	94	103
3	Roof	96.6	104	99	91/93
4	Left Front Fender	84.1	87	83	83
5	Left Front Door	112.6	105	114	119
6	Center Panel Left				
7	Left Rear Door	307.0	375	266	280
8	Left Back Panel	169.3	191	162	155
9	Right Front Fender	94.4	95	93	96
10	Right Front Door	95.2	96	98	92
11	Center Panel Right				
12	Right Rear Door	93.5	99	90	91
13	Right Back Panel	94.7	95	95	95

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : A
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / Rear Seat - Grime - Small / (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Seat - Grime - Medium	Remarks (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Dent - Small / (L) Front Fender, Molding - Dent - Minimal
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Horn - Issue - Yes

Inspector Notes

park light, reverse light and fog lights not working. with spare tire, jack but incomplete tools. without warranty booklet. with LTO plate. check engine light, battery light, maintenance light, abs light, airbag warning light, steering light shown at the instrument panel. all power windows not working. aircon not working.