

General Information

Date & Time: 15, May, 2026 15:44

Make	Toyota	Model	Hiace
YOM	2025	Odo Meter Reading	34,178
Registration No.	NJA9627	Chassis No.	JTFJT02P1S0019723
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



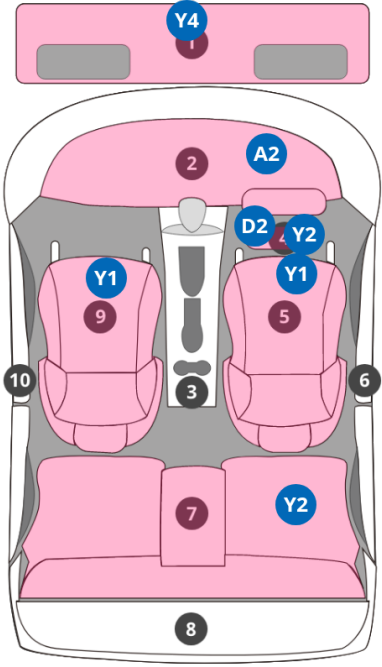
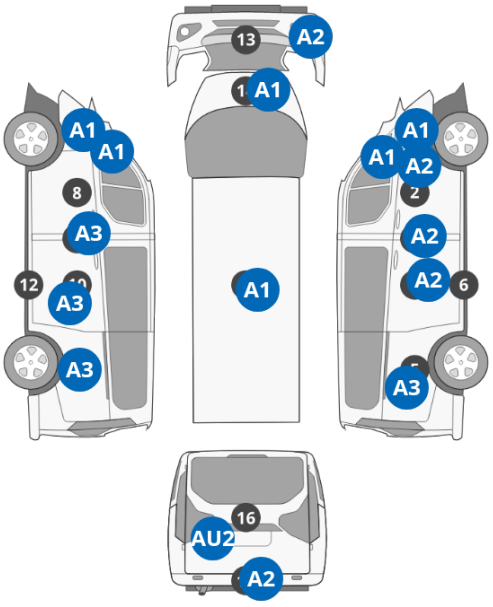
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	72.5	78	73	68
2	Boot Lid	75.1	76	80	69
3	Roof	70.4	62	70	71/79
4	Left Front Fender	77.3	71	79	83
5	Left Front Door	70.9	73	76	64
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	73.4	75	80	66
9	Right Front Fender	73.3	74	74	73
10	Right Front Door	76.8	68	75	88
11	Center Panel Right	72.0	83	67	67
12	Right Rear Door	98.6	74	74	148
13	Right Back Panel	74.1	72	74	77

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Worked - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / Rear Seat - Grime - Small	Remarks (R) Rear Door - Repair Traces - Yes / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Center Panel - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Front Panel - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on headlight and tail light, rear seat loose/nut missing/nit fully attached