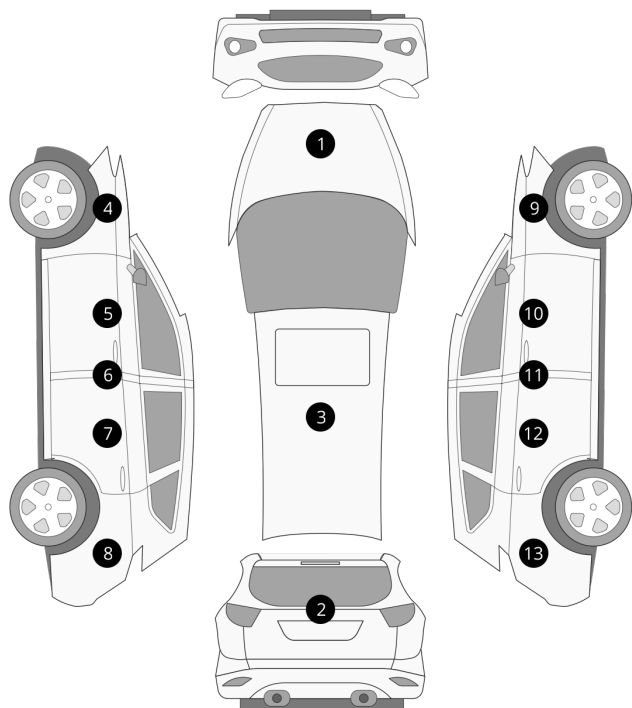


General Information

Date & Time: 19, May, 2026 10:51

Make	Toyota	Model	Hilux
YOM	2025	Odo Meter Reading	34,146
Registration No.	NKO6560	Chassis No.	MR0JB8DD7S3236786
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	White		

Body / Panel Condition



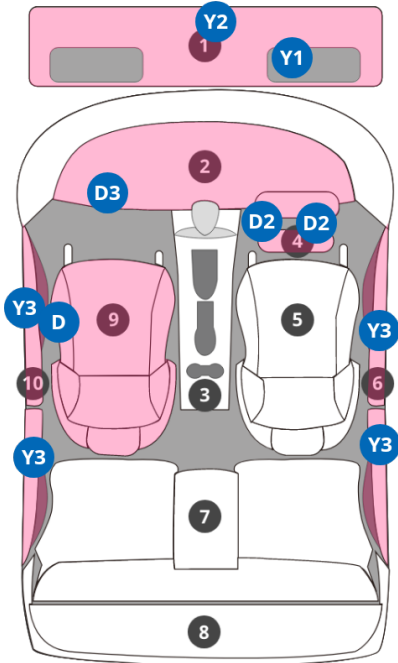
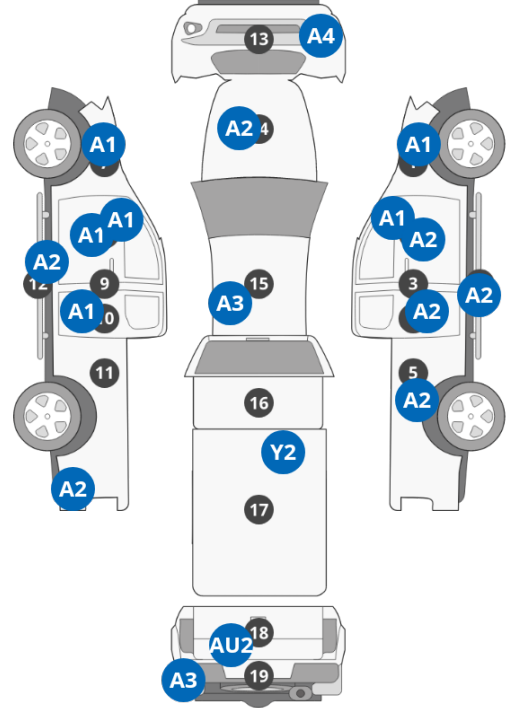
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.0	111	117	111
2	Boot Lid	101.0	101	100	102
3	Roof	96.9	93	96	94/105
4	Left Front Fender	98.9	96	102	99
5	Left Front Door	96.6	89	97	104
6	Center Panel Left				
7	Left Rear Door	100.4	107	95	99
8	Left Back Panel	95.2	92	100	94
9	Right Front Fender	104.2	94	110	109
10	Right Front Door	102.2	116	97	94
11	Center Panel Right				
12	Right Rear Door	97.5	100	89	104
13	Right Back Panel	99.2	96	108	94

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Medium / (L) Rear Trim - Grime - Medium / (R) Rear Trim - Grime - Medium / (R) Front Trim - Grime - Medium / (L) Front Seat - Worn - Yes / Ceiling - Grime - Small / Sunvisor, Sunglass Holder - Grime - Minimal / Dashboard - Loose, Deformed - Medium / (R) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Worked - Small	Remarks Front Bumper, Grille, Lamps - Scratch - Large / Roof - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Side Gate - Scratch - Small / Rear Gate - Scratch & Dent - Small / Cargo Bed Floor - Crack, Gap - Small / (L) Side Gate - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / (L) Mirror - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Power Steering - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
with LTO plate/warranty booklet/no tools and jack/no spare tire/ aircon issue/signal light issue/traction control indicator on/abs lamp on/ airbag lamp on/brake issue/brake light issue/power window issue/door lock issue/retractable side mirror issue/power steering lamp on/warning lamp on/difficulty of starting the vehicle/hairline scratches on the body