

General Information

Date & Time: 13, Jul, 2026 15:57

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	17,234
Registration No.	NKU2218	Chassis No.	PAHACACA1S6425612
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



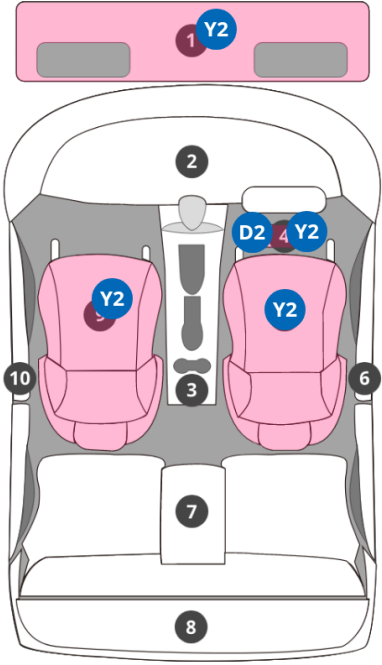
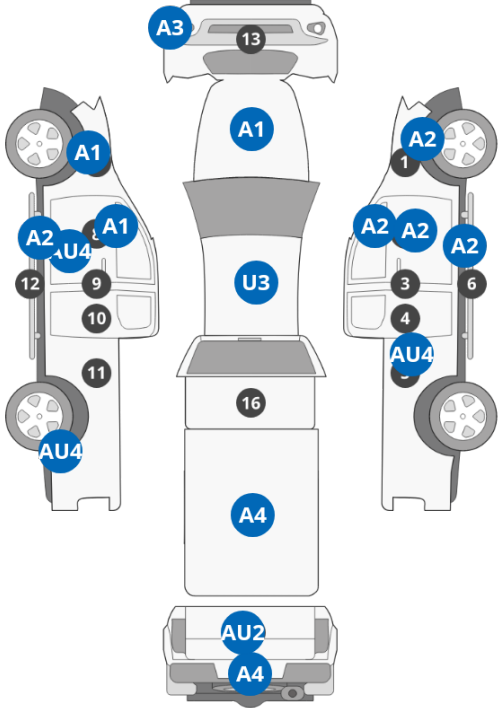
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.6	98	102	93
2	Boot Lid	59.4	64	54	60
3	Roof	111.7	121	117	109/100
4	Left Front Fender	108.6	111	106	109
5	Left Front Door	103.6	103	108	100
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	61.7	60	71	54
9	Right Front Fender	104.6	114	104	96
10	Right Front Door	102.1	98	105	104
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	56.3	57	59	53

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Ceiling - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Worked - Small	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Side Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Large / Cargo Bed Floor - Scratch - Large / Rear Gate - Scratch & Dent - Small / (L) Side Gate - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Dent - Medium
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Shift Shock - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
Non moving unit/Clutch issue/no LTO plate/with warranty booklet/no tools and jack/no spare tire/no spare key/scratches on side windows/broken antenna