

General Information

Date & Time: 15, May, 2026 15:51

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	34,843
Registration No.	NKU4466	Chassis No.	PAHACACA6S6426240
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



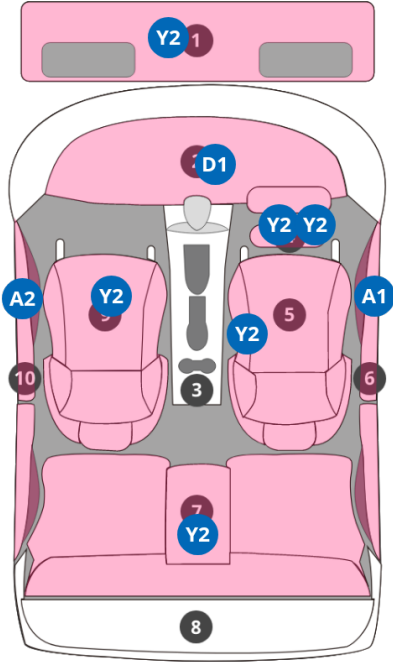
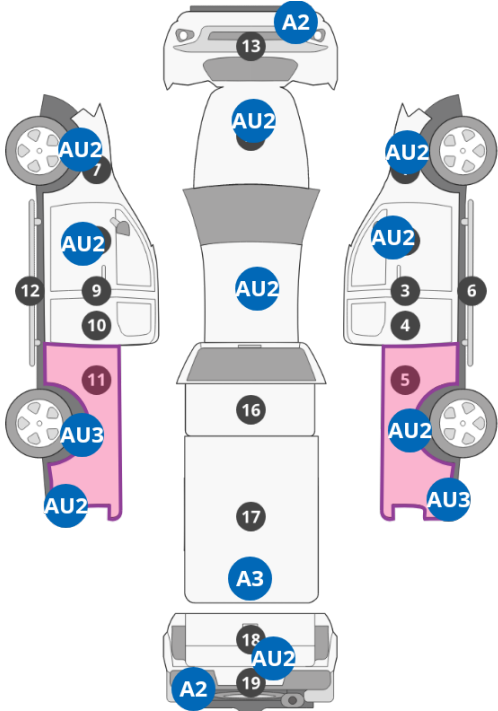
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.6	103	104	104
2	Boot Lid	68.7	78	71	58
3	Roof	126.2	130	115	124/136
4	Left Front Fender	108.6	111	113	102
5	Left Front Door	104.0	105	107	100
6	Center Panel Left	106.4	114	106	99
7	Left Rear Door				
8	Left Back Panel	125.3	213	86	77
9	Right Front Fender	116.3	107	111	131
10	Right Front Door	106.3	101	107	111
11	Center Panel Right	108.6	114	104	108
12	Right Rear Door				
13	Right Back Panel	85.7	86	86	85

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Front Trim - Cut, Crack - Small / (R) Front Trim - Cut, Crack - Minimal / Ceiling - Grime - Small / Rear Seat - Grime - Small / Dashboard - Worked - Minimal	Remarks Bonnet - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Side Gate - Scratch & Dent - Medium / (L) Guard Frame - Scratch & Dent - Small / (L) Guard Frame - Repair mark - Yes / (R) Guard Frame - Scratch & Dent - Medium / (R) Side Gate - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Side Gate - Repair mark - Yes / Cargo Bed Floor - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / Rear Gate - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Reverse Camera - N/A - Yes

Inspector Notes
with LTO plate, with jack, with spare tire and key, with manual and warranty booklet, scratches on exterior, check engine indicator on, scratches on taillight and headlight, no reverse camera, maintenance indicator on.