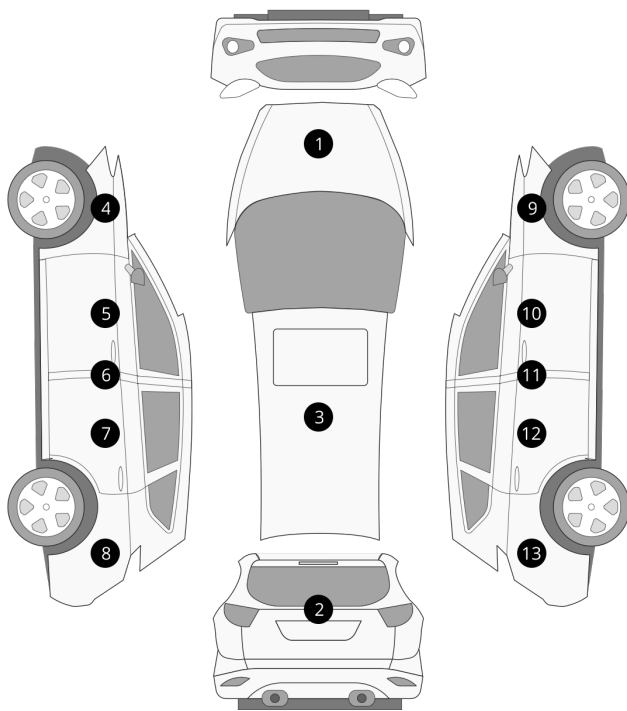


General Information

Date & Time: 20, May, 2026 15:29

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	14,197
Registration No.	DCD1437	Chassis No.	PAHACACA7S6422472
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Dropside
Colour	White		

Body / Panel Condition



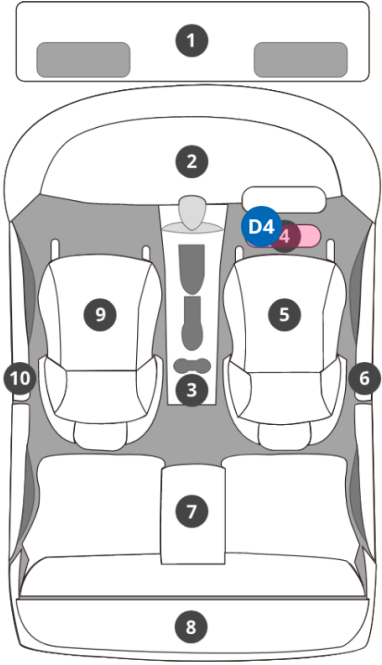
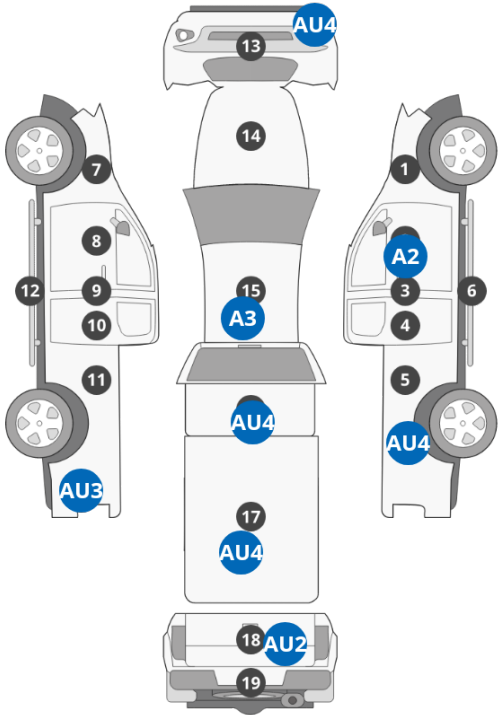
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.6	108	104	102
2	Boot Lid	53.4	56	47	58
3	Roof	96.2	101	101	61/122
4	Left Front Fender	111.3	104	111	119
5	Left Front Door	110.0	103	110	117
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	73.7	99	53	69
9	Right Front Fender	101.6	100	105	100
10	Right Front Door	104.0	100	109	103
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	123.4	82	127	161

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Large	Remarks (L) Side Gate - Scratch & Dent - Medium / Cargo Bed Floor - Scratch & Dent - Large / Rear Gate - Scratch & Dent - Small / (R) Side Gate - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Small / Roof - Scratch - Medium / Cab Back Panel - Scratch & Dent - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet/ with spare tire and jack/ with LTO plate and tools/