

General Information

Date & Time: 18, May, 2026 17:34

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	26,111
Registration No.	CCQ2447	Chassis No.	PA1B18F3XS4291953
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



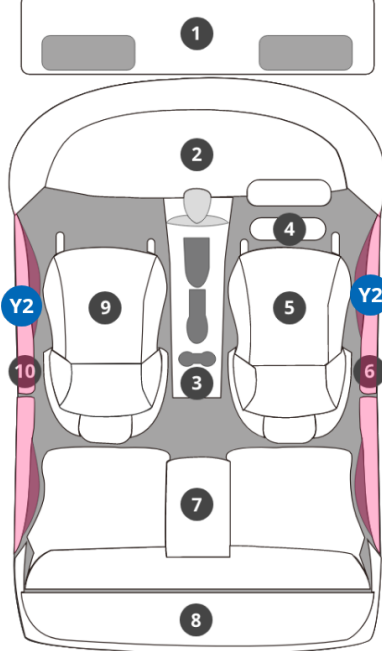
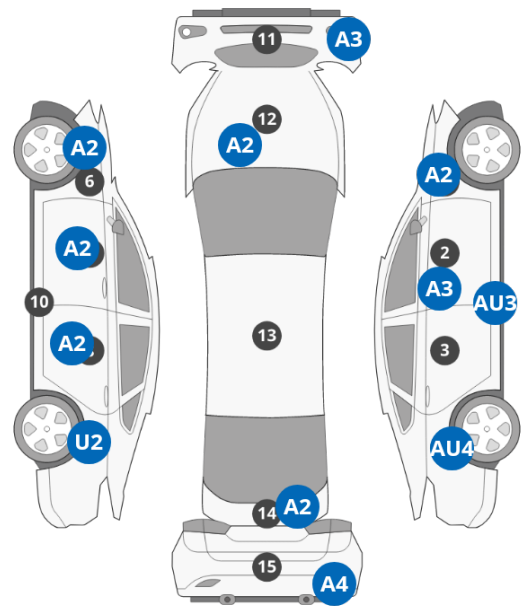
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.0	129	110	124
2	Boot Lid	116.6	112	117	121
3	Roof	110.2	109	115	106/111
4	Left Front Fender	93.8	82	88	112
5	Left Front Door	115.3	118	112	116
6	Center Panel Left				
7	Left Rear Door	110.0	110	110	110
8	Left Back Panel	119.6	125	122	112
9	Right Front Fender	115.3	111	110	125
10	Right Front Door	112.6	117	110	111
11	Center Panel Right				
12	Right Rear Door	110.0	104	111	115
13	Right Back Panel	119.3	120	114	124

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Fender, Molding - Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

incomplete tools and no spare tire/ light scratches around the exterior/ no warranty booklet/ with LTO plate and Jack/