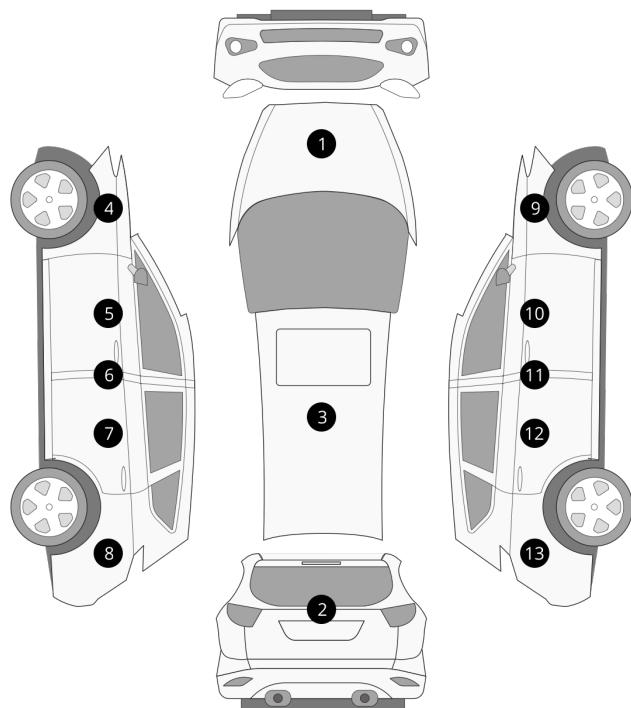


General Information

Date & Time: 20, May, 2026 15:53

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	90,126
Registration No.	DAQ8671	Chassis No.	PA1B18F36N4179381
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



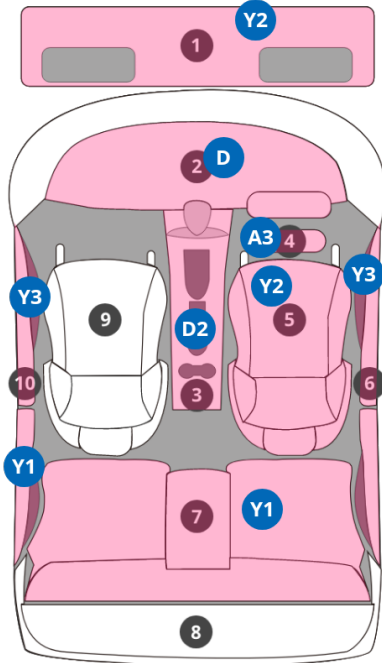
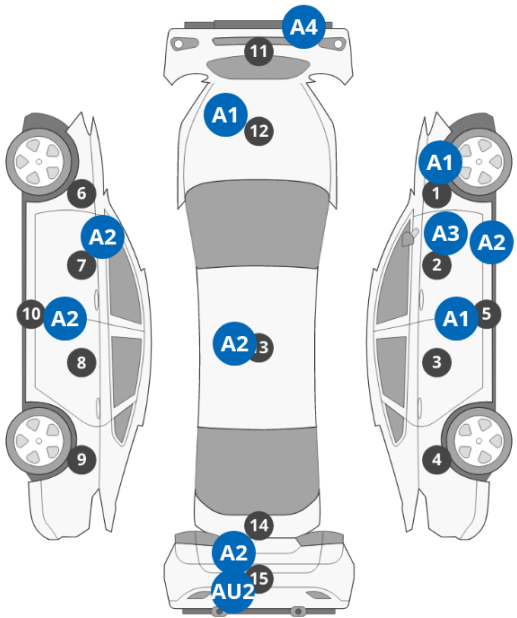
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	106	115	107
2	Boot Lid	117.6	116	109	128
3	Roof	101.4	104	107	92/103
4	Left Front Fender	105.4	98	110	108
5	Left Front Door	110.6	106	113	113
6	Center Panel Left				
7	Left Rear Door	112.6	117	110	111
8	Left Back Panel	122.6	137	119	112
9	Right Front Fender	104.5	109	99	106
10	Right Front Door	107.3	100	102	120
11	Center Panel Right				
12	Right Rear Door	149.0	150	140	157
13	Right Back Panel	169.3	142	169	197

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / Carpet - Worn, Scratch, Cut, Crack - Medium / (L) Front Trim - Grime - Medium / Ceiling - Grime - Small / (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Medium / Console, Switches, Vents - Loose, Deformed - Small / Rear Seat - Grime - Minimal / (L) Rear Trim - Grime - Minimal	Remarks (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Roof - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal / (L) Mirror - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with Ito plate/with tools no jack/with hairlines scratches on the body/without spare tire/without manual and warranty booklet/no reverse camera/without spare key