

General Information

Date & Time: 20, May, 2026 14:49

Make	Toyota	Model	Lite Ace
YOM	2024	Odo Meter Reading	103,473
Registration No.	DBM6449	Chassis No.	MHKU3FE10PK006262
CC	1.5	Transmission	M/T
Fuel Type	Gas	Type of Body	Van
Colour	White		

Body / Panel Condition



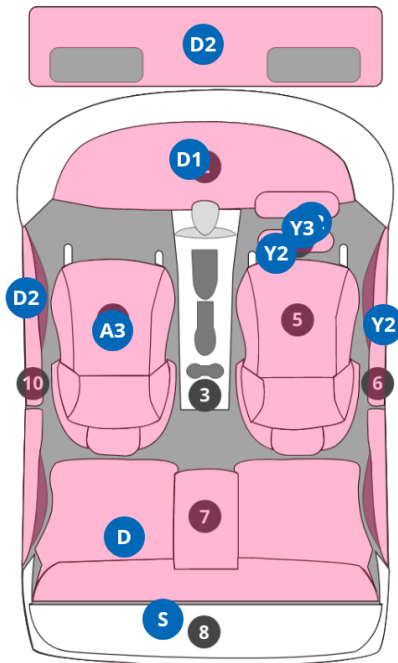
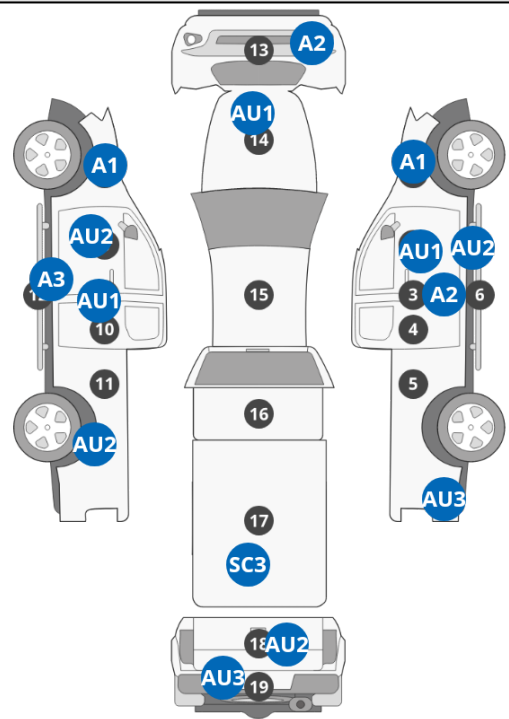
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	64.4	60	65	68
2	Boot Lid	77.9	94	66	74
3	Roof	72.2	56	66	59/109
4	Left Front Fender	101.0	96	109	98
5	Left Front Door	64.6	71	60	64
6	Center Panel Left	64.4	75	57	62
7	Left Rear Door				
8	Left Back Panel	91.3	72	112	90
9	Right Front Fender	70.3	76	68	67
10	Right Front Door	70.4	65	66	81
11	Center Panel Right	66.8	75	60	66
12	Right Rear Door				
13	Right Back Panel	82.1	91	87	69

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Worn - Yes / Overall Interior - Smell - Yes / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Medium / (L) Front Seat - Fray - Medium / (R) Front Seat - Grime - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Grime - Small / Ceiling - Crinkle - Small / Dashboard - Worked - Minimal	Remarks Front Panel - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Center Panel - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Center Panel - Scratch & Dent - Minimal / (L) Side Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Side Gate - Scratch & Dent - Medium / Rear Gate - Scratch & Dent - Small / Cargo Bed Floor - Rust, Corrosion - Medium
Frame Evaluation : B	Functional Evaluation : C
Remarks Front Floor and Side Member - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes

Inspector Notes
with LTO plate, with spare tire and key, no tools and jack, no warranty and manual booklet, aircon issue, scratches and dent on exterior, scratches on taillight and headlight, issue on taillight.