

General Information

Date & Time: 25, May, 2026 12:56

Make	Toyota	Model	Hiace
YOM	2025	Odo Meter Reading	29,481
Registration No.	DBT8466	Chassis No.	JTFJT02PXS5040203
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



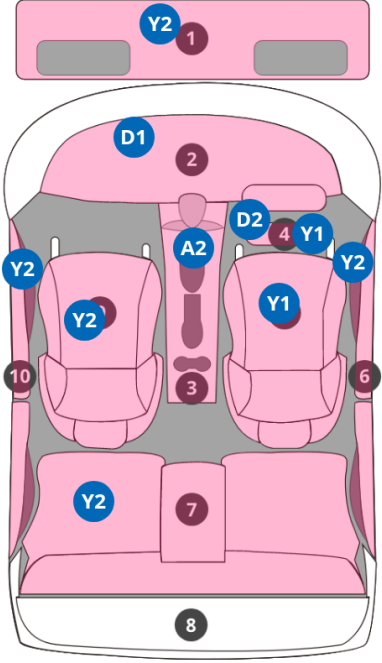
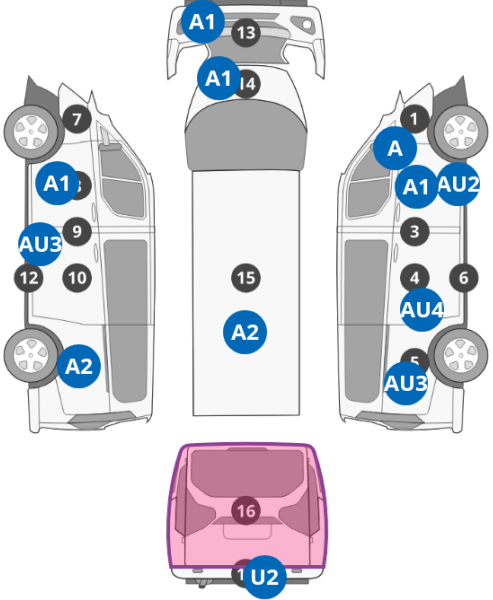
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	132.3	113	153	131
2	Boot Lid	116.6	116	107	127
3	Roof	131.0	133	132	115/144
4	Left Front Fender				
5	Left Front Door	123.3	120	125	125
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	127.0	111	126	144
9	Right Front Fender				
10	Right Front Door	112.3	108	112	117
11	Center Panel Right	130.3	138	133	120
12	Right Rear Door	117.6	115	122	116
13	Right Back Panel	123.3	125	114	131

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Small / Dashboard - Worked - Minimal / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Knobs - Worn, Peel, Crack - Small / (R) Front Floor Mat - Grime - Minimal	Remarks Trunk Hood, Rear Gate - Partially Missing - Yes / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Mirror - Scratch, Peeled - Yes / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Minimal / Roof - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Front Panel - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with Ito plate/with manual no warranty booklet/with spare tire/with tools no jack/with hairlines scratches on the body/no reverse camera/no spare key