

General Information

Date & Time: 19, Feb, 2025 10:22

Make	Suzuki	Model	Dzire
YOM	2024	Mileage	7,932
Registration No.	NIS2939	Chassis No.	MBHZF63S5RG415867
CC	1.2	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Gray		

Body / Panel Condition



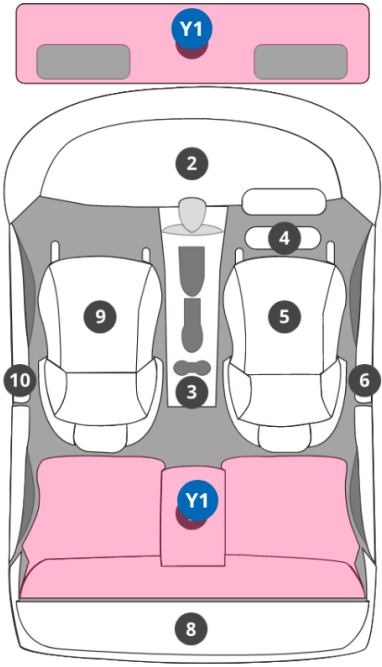
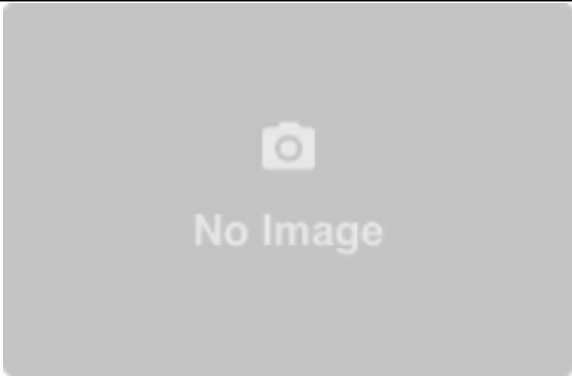
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.6	95	99	100
2	Boot Lid	81.7	91	78	77
3	Roof	100.8	91	94	108/111
4	Left Front Fender	98.8	102	101	94
5	Left Front Door	98.1	99	100	95
6	Center Panel Left				
7	Left Rear Door	100.3	104	101	96
8	Left Back Panel	94.3	95	94	94
9	Right Front Fender	98.8	101	98	98
10	Right Front Door	97.3	97	96	99
11	Center Panel Right				
12	Right Rear Door	96.2	93	98	98
13	Right Back Panel	102.6	100	105	103

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Minimal / Ceiling - Grime - Minimal	Remarks (L) Front Door, Molding - Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Front Fender, Molding - Dent - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
without warranty booklet, tools and jack. with spare tire. with LTO plate.