

General Information

Date & Time: 22, May, 2026 07:42

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	26,807
Registration No.	EAJ7478	Chassis No.	PA1B18F36R4275887
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



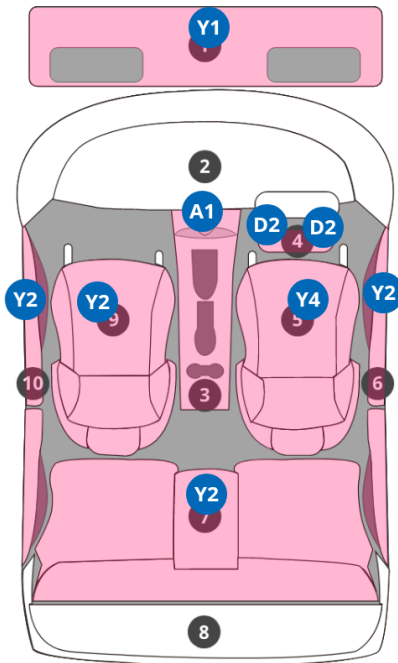
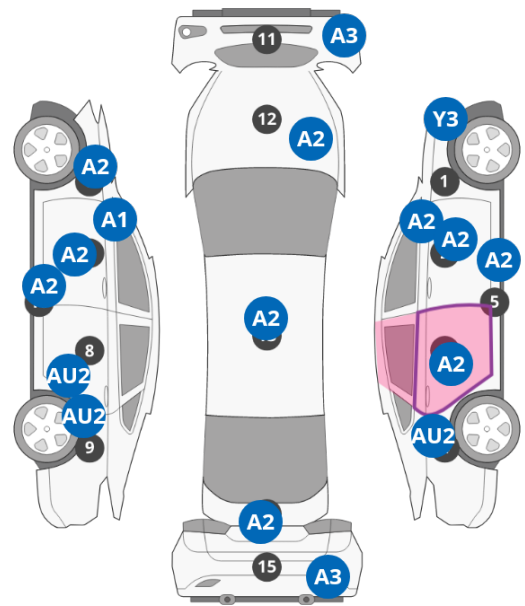
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.7	98	100	99
2	Boot Lid	97.8	92	105	97
3	Roof	87.0	87	87	86/88
4	Left Front Fender	90.6	101	86	85
5	Left Front Door	91.8	90	90	95
6	Center Panel Left				
7	Left Rear Door	87.8	88	88	87
8	Left Back Panel	101.0	99	101	103
9	Right Front Fender	92.0	90	90	96
10	Right Front Door	97.5	99	100	94
11	Center Panel Right				
12	Right Rear Door	96.8	100	89	102
13	Right Back Panel	103.9	98	99	115

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / (R) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / Rear Seat - Grime - Small / (R) Front Seat - Grime - Large / Ceiling - Grime - Minimal / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Minimal	Remarks (R) Front Fender, Molding - Crack, Gap - Medium / (R) Mirror - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with warranty booklet/with incomplete tools with jack/with spare tire/hairline scratches on the body