

General Information

Date & Time: 20, May, 2026 14:41

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	22,984
Registration No.	CDA7252	Chassis No.	PAHAD9DA0S1627977
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Dropside
Colour	Black		

Body / Panel Condition



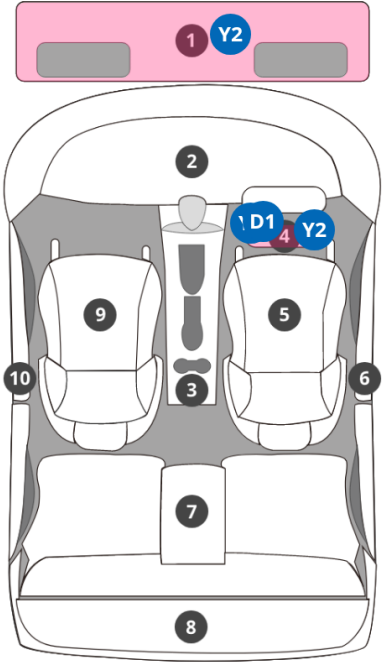
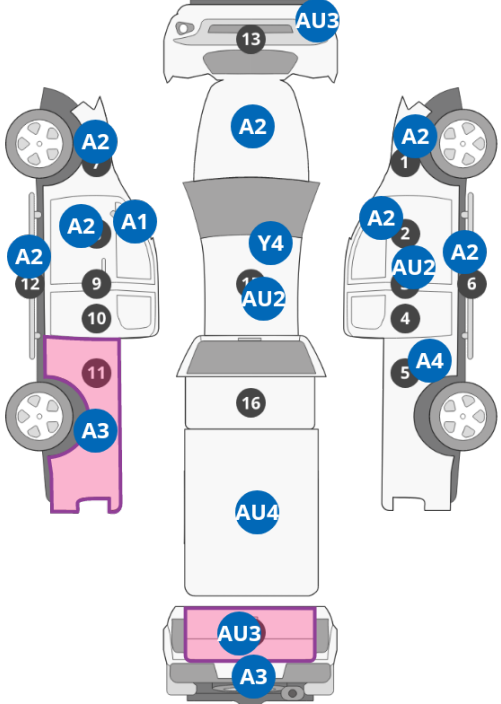
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	96.3	98	101	90
2	Boot Lid	77.9	85	71	78
3	Roof	118.7	126	119	112/118
4	Left Front Fender	112.0	109	122	105
5	Left Front Door	98.4	104	96	96
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	77.1	84	74	73
9	Right Front Fender	122.3	115	136	116
10	Right Front Door	103.4	97	102	111
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	96.4	73	108	108

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Small / Ceiling - Grime - Small / Carpet - Worked - Minimal	Remarks (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Side Gate - Scratch - Medium / Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Side Gate - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Small / Front Windshield - Damaged - Large / Cargo Bed Floor - Scratch & Dent - Large / Roof - Scratch & Dent - Small / (L) Side Gate - Repair mark - Yes / Rear Gate - Repair mark - Yes
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate/no warranty booklet/no tools with jack/with spare tire/roof rack issue/tailight cover issue/hairline scratches on the body/crack on front windshield