

General Information

Date & Time: 20, May, 2026 15:59

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	41,321
Registration No.	NEY4490	Chassis No.	PA1B18F30R4257112
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



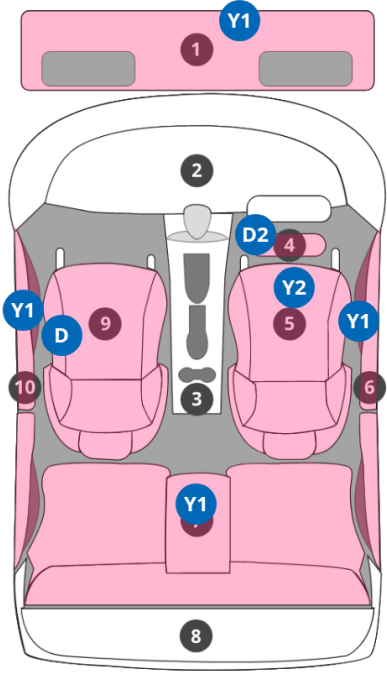
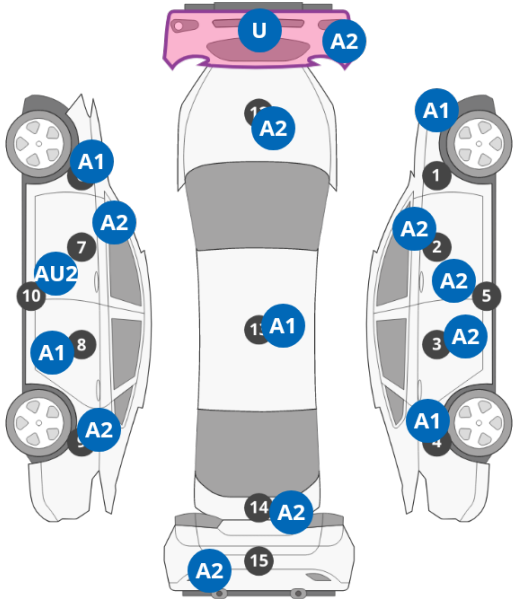
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	162.3	146	170	171
2	Boot Lid	124.0	125	118	129
3	Roof	101.1	95	109	103/97
4	Left Front Fender	158.0	171	162	141
5	Left Front Door	109.0	105	104	118
6	Center Panel Left				
7	Left Rear Door	114.3	119	111	113
8	Left Back Panel	117.3	93	146	113
9	Right Front Fender	175.3	164	184	178
10	Right Front Door	101.6	96	102	107
11	Center Panel Right				
12	Right Rear Door	110.3	113	114	104
13	Right Back Panel	107.6	108	104	111

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small / (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Small / Ceiling - Grime - Minimal / Rear Seat - Grime - Minimal / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Condition of Welding ? - Yes	Remarks Defects not found

Inspector Notes
no warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on tail light