

General Information

Date & Time: 22, May, 2026 07:39

Make	Toyota	Model	Innova
YOM	2024	Odo Meter Reading	52,235
Registration No.	NFR7748	Chassis No.	PA2JA8EM9R0142081
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red		

Body / Panel Condition



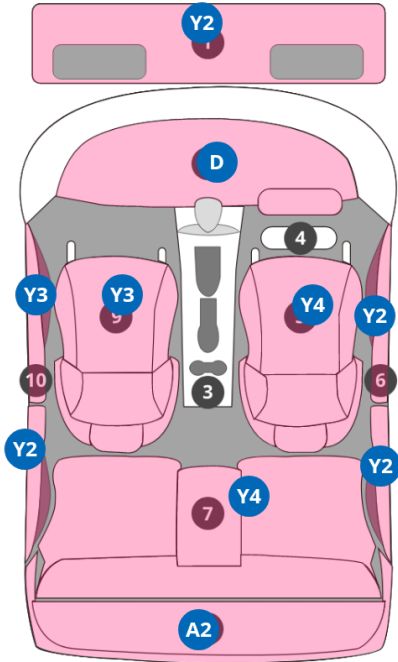
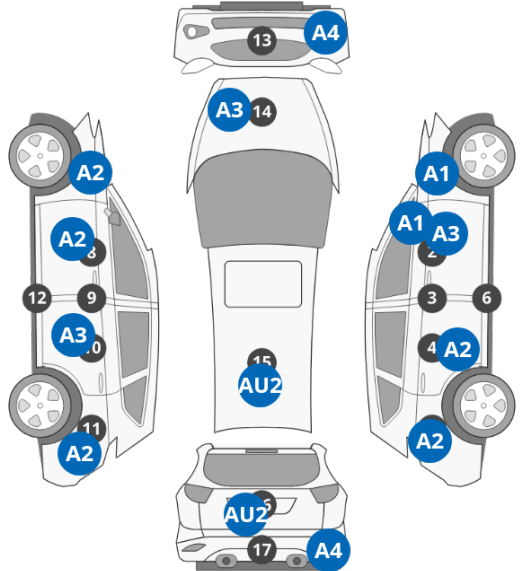
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.1	100	121	110
2	Boot Lid	150.3	166	152	133
3	Roof	96.8	95	99	99/95
4	Left Front Fender	101.3	100	103	101
5	Left Front Door	100.5	100	104	98
6	Center Panel Left				
7	Left Rear Door	106.6	115	101	104
8	Left Back Panel	101.2	103	109	92
9	Right Front Fender	97.4	101	103	88
10	Right Front Door	96.3	95	97	96
11	Center Panel Right				
12	Right Rear Door	99.7	98	100	101
13	Right Back Panel	110.5	97	114	121

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Small / Rear Seat - Grime - Large / (R) Rear Trim - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Medium / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Shift Shock - Function - Weak / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Seat Belts - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate/with spare tire/No spare key/No seat cover/possible flooding/front and back floor mats missing/reverse camera issue/head unit issue/No fog light/headlight issue/shift shock issue/Interior dirty/No jack and tools/No warranty booklets/unusual sound engine/dome light issue/right side rear trunk trim cover issue/seatbelts issue/steering wheel issue/top radiator cover missing/glove box issue/