

General Information

Date & Time: 19, May, 2026 15:51

Make	Toyota	Model	Avanza
YOM	2024	Odo Meter Reading	40,189
Registration No.	NFR2596	Chassis No.	MHFAA1BY2R0024621
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Black		

Body / Panel Condition



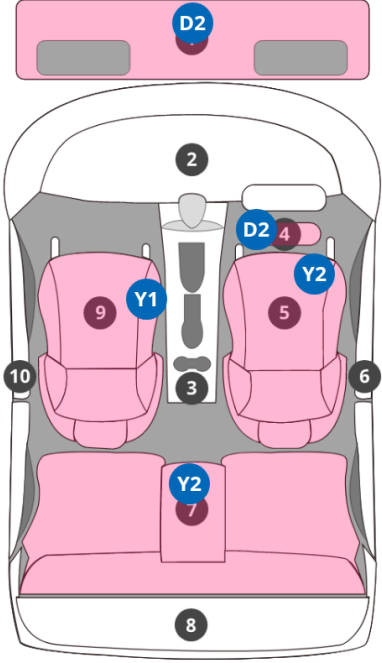
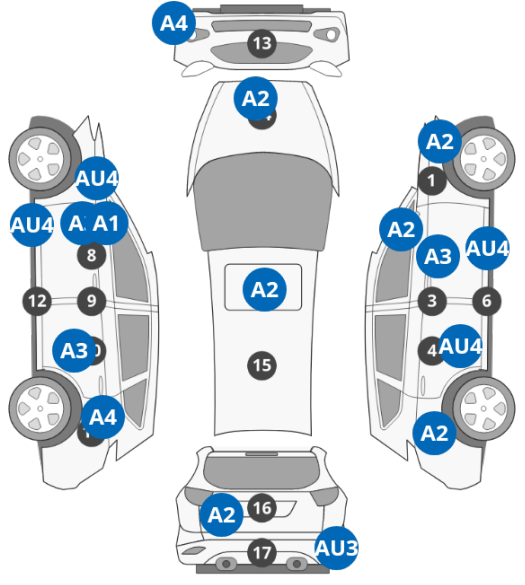
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.0	118	103	109
2	Boot Lid	100.5	93	104	105
3	Roof	111.5	119	117	103/107
4	Left Front Fender	98.0	100	95	99
5	Left Front Door	113.0	108	113	118
6	Center Panel Left				
7	Left Rear Door	110.0	115	107	108
8	Left Back Panel	116.6	125	119	106
9	Right Front Fender	103.9	106	106	100
10	Right Front Door	113.0	121	111	107
11	Center Panel Right				
12	Right Rear Door	113.0	112	117	110
13	Right Back Panel	116.0	124	116	108

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Crinkle - Small / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Minimal / Rear Seat - Grime - Small	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A Remarks Defects not found	Functional Evaluation : A Remarks Defects not found

Inspector Notes
with warranty booklet and jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light, touch up/ repair mark on some panel