

General Information

Date & Time: 23, May, 2026 08:14

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	91,358
Registration No.	NHS5059	Chassis No.	PA1B18F33R4263440
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



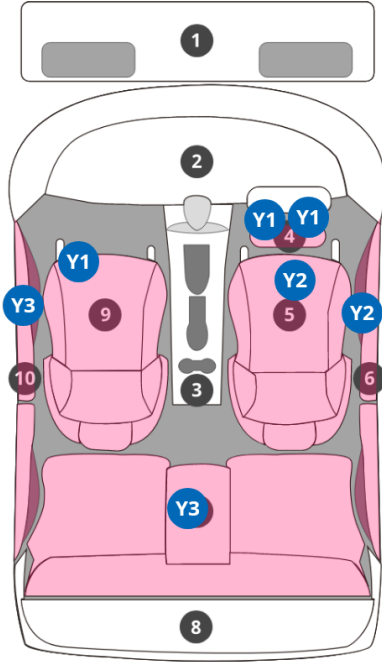
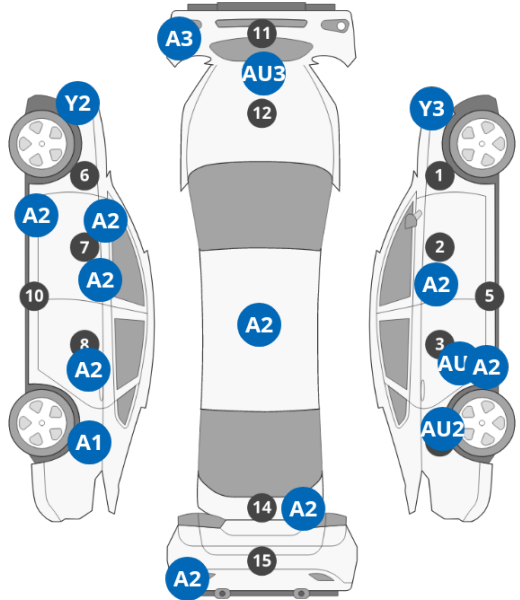
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.5	100	107	107
2	Boot Lid	113.0	105	114	120
3	Roof	98.2	109	95	97/92
4	Left Front Fender	101.3	107	97	100
5	Left Front Door	107.0	105	109	107
6	Center Panel Left				
7	Left Rear Door	103.0	101	107	101
8	Left Back Panel	115.3	121	116	109
9	Right Front Fender	95.1	97	90	98
10	Right Front Door	94.8	98	98	89
11	Center Panel Right				
12	Right Rear Door	98.3	93	100	102
13	Right Back Panel	102.1	104	97	106

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Minimal / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Grime - Minimal / (L) Front Seat - Grime - Minimal	Remarks (L) Front Fender, Molding - Crack, Gap - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Crack, Gap - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Medium / Roof - Scratch - Small
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Head Light, High Beam - Issue - Yes / Horn - Issue - Yes

Inspector Notes
with LTO plate/no warranty booklet/no tools with jack/with spare tire/headlight issue/horn issue/room light issue/hairline scratches on the body