

General Information

Date & Time: 23, May, 2026 06:44

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	13,399
Registration No.	NJA2785	Chassis No.	PA1B18F36S4281694
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



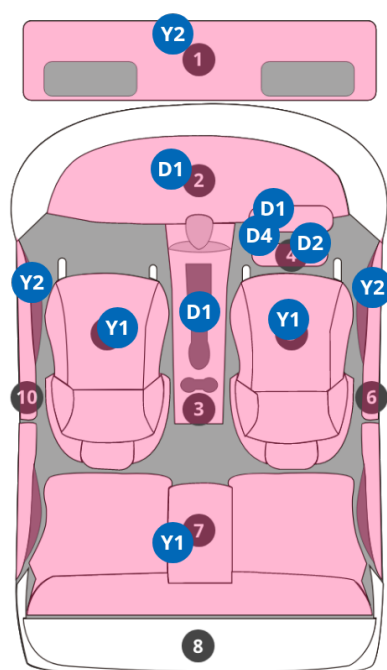
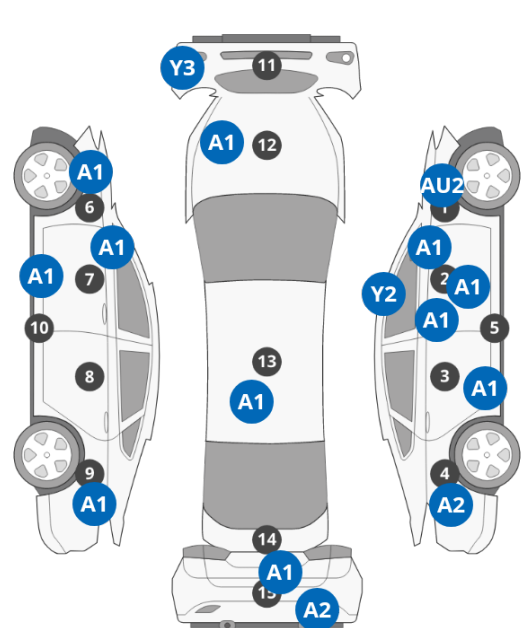
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.6	101	95	97
2	Boot Lid	112.3	101	121	115
3	Roof	94.0	93	98	90/94
4	Left Front Fender	93.2	95	94	91
5	Left Front Door	96.3	94	95	100
6	Center Panel Left				
7	Left Rear Door	93.6	93	98	90
8	Left Back Panel	109.7	114	117	98
9	Right Front Fender	106.4	133	88	99
10	Right Front Door	101.2	100	94	110
11	Center Panel Right				
12	Right Rear Door	102.9	100	99	110
13	Right Back Panel	104.0	102	94	116

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / Dashboard - Worked - Minimal / Glove Box - Loose, Deformed - Minimal / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (R) Front Floor Mat - Worked - Large / (L) Front Floor Mat - Worked - Small / Rear Seat - Grime - Minimal / Console, Switches, Vents - Worked - Minimal	Remarks (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch, Peeled - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Roof - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium / (R) Side Window - Damaged - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes

with lto plate/with spare tire/without warranty and manual/no tools and jack/without spare key