

General Information

Date & Time: 22, May, 2026 07:44

Make	Toyota	Model	Hilux Tamaraw
YOM	2026	Odo Meter Reading	10,784
Registration No.	NJG2007	Chassis No.	PAHACACA8S6429771
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



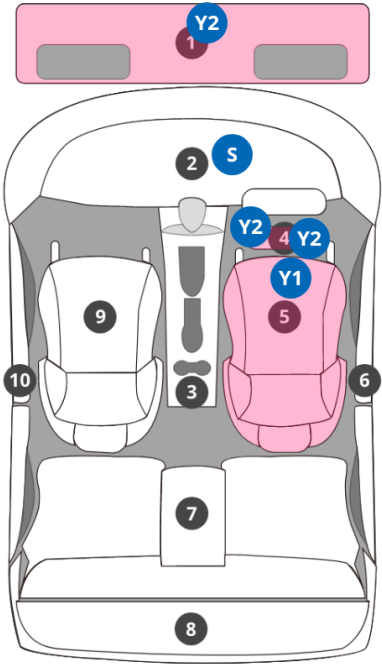
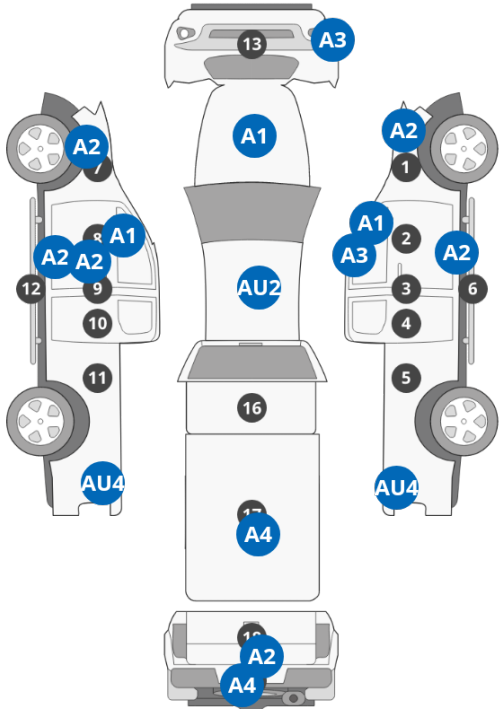
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.7	97	108	92
2	Boot Lid	56.0	64	51	54
3	Roof	108.2	113	114	103/103
4	Left Front Fender	99.3	98	100	100
5	Left Front Door	99.7	98	100	101
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	60.1	57	61	62
9	Right Front Fender	99.6	101	106	92
10	Right Front Door	102.3	102	102	103
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	57.1	58	58	56

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Seat - Grime - Minimal / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Small / Overall Interior - Smell - Yes	Remarks (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Side Gate - Scratch & Dent - Large / Roof - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Rear Gate - Scratch - Small / Cargo Bed Floor - Scratch - Large / (R) Side Gate - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate/with warranty booklet/with incomplete tools with jack/with spare tire/hairline scratches on the body/fuel lid issue