

General Information

Date & Time: 23, May, 2026 15:55

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	16,486
Registration No.	NJQ2321	Chassis No.	PAHACACA9S6424921
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



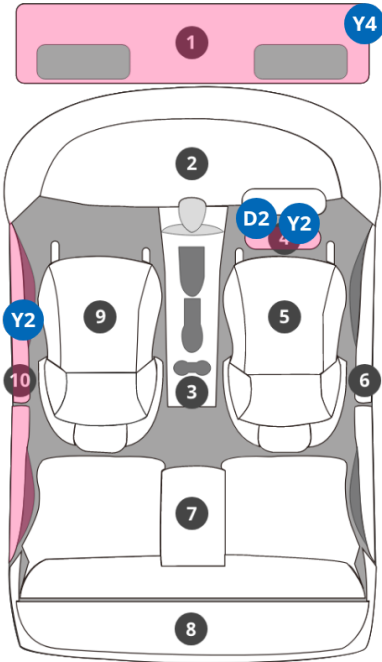
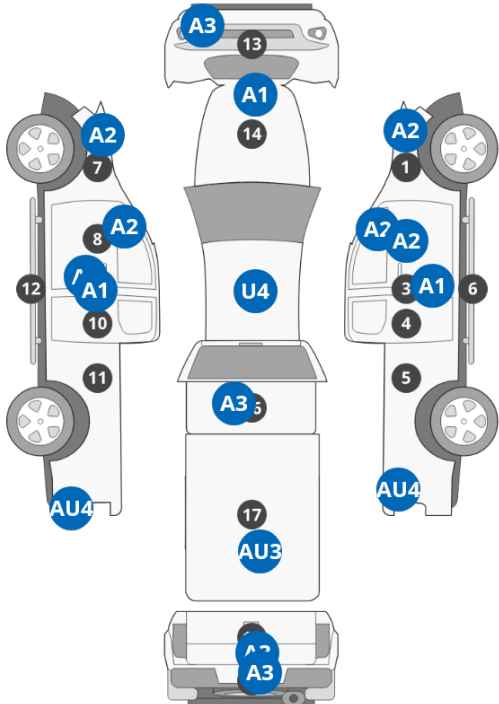
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.4	102	98	101
2	Boot Lid	59.6	59	55	66
3	Roof	107.0	116	108	109/95
4	Left Front Fender	102.1	99	102	105
5	Left Front Door	96.1	97	97	94
6	Center Panel Left	86.4	89	83	87
7	Left Rear Door				
8	Left Back Panel	73.3	96	63	61
9	Right Front Fender	100.8	109	101	93
10	Right Front Door	101.0	102	101	100
11	Center Panel Right	100.7	105	105	92
12	Right Rear Door				
13	Right Back Panel	69.7	73	72	64

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Trim - Grime - Small / Ceiling - Grime - Large / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Small	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Center Panel - Scratch - Minimal / (R) Side Gate - Scratch & Dent - Large / Rear Gate - Scratch - Medium / (L) Side Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / Cab Back Panel - Scratch - Medium / Cargo Bed Floor - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Center Panel - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Dent - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes

with warranty and jack, no tools, with spare tire, with LTO plate but not attached, scratches on tail light