

## General Information

Date & Time: 22, May, 2026 07:46

|                  |         |                   |                   |
|------------------|---------|-------------------|-------------------|
| Make             | Toyota  | Model             | Vios              |
| YOM              | 2025    | Odo Meter Reading | 86,358            |
| Registration No. | NKE8569 | Chassis No.       | PA1B18F35R4266341 |
| CC               | 1.3     | Transmission      | CVT               |
| Fuel Type        | Gas     | Type of Body      | Sedan             |
| Colour           | Blue    |                   |                   |

## Body / Panel Condition



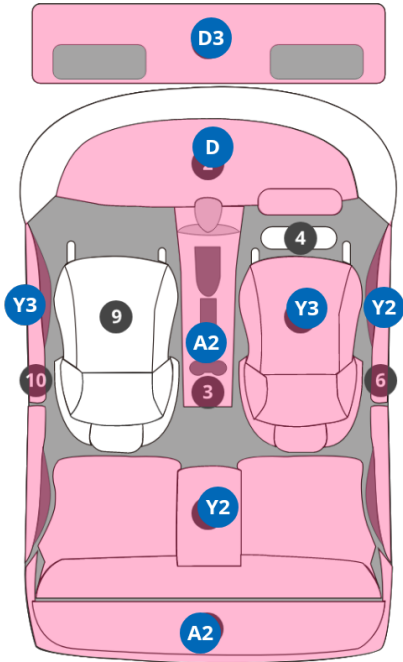
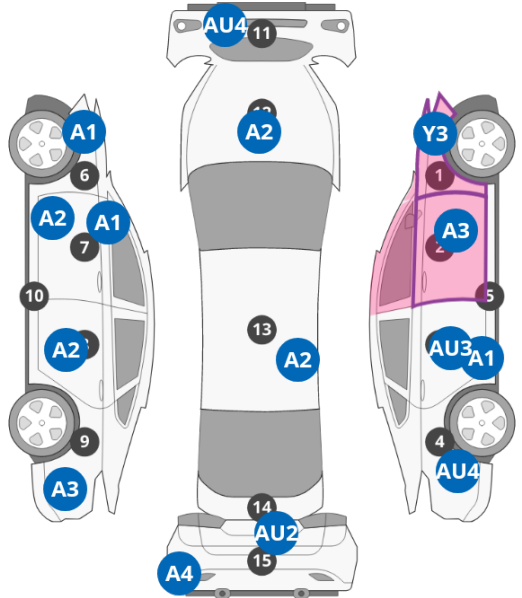
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 110.0         | 111    | 106    | 113      |
| 2  | Boot Lid           | 109.3         | 105    | 113    | 110      |
| 3  | Roof               | 101.3         | 108    | 99     | 100/99   |
| 4  | Left Front Fender  | 102.0         | 102    | 99     | 105      |
| 5  | Left Front Door    | 111.3         | 105    | 115    | 114      |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 120.6         | 133    | 115    | 114      |
| 8  | Left Back Panel    | 112.6         | 123    | 108    | 107      |
| 9  | Right Front Fender | 496.0         | 807    | 531    | 150      |
| 10 | Right Front Door   | 356.6         | 173    | 148    | 749      |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 105.0         | 102    | 103    | 110      |
| 13 | Right Back Panel   | 103.1         | 99     | 101    | 110      |

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| Interior Evaluation : <b>C</b>                                                                                                                                                                                                                                                                                                                       | Exterior Evaluation : <b>E</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                     |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>                                                                                                   |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |
| <p><b>Remarks</b></p> <p>(R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Medium / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Ceiling - Crinkle - Medium / Dashboard - Traces of Adhesive Tape - Yes</p> | <p><b>Remarks</b></p> <p>(R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Trunk Hood, Rear Gate - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / (R) Front Fender, Molding - Crack, Gap - Medium / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch &amp; Dent - Medium / (R) Rear Fender, Molding - Scratch &amp; Dent - Large / Roof - Scratch - Small</p> |
| Frame Evaluation : <b>B</b>                                                                                                                                                                                                                                                                                                                          | Functional Evaluation : <b>C</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |
| <p><b>Remarks</b></p> <p>Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>                                                                                                                                                                                                                                        | <p><b>Remarks</b></p> <p>Shift Shock - Function - Weak / Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                         |

| Inspector Notes                                                                                                                                                                                                                                                         |
|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <p>with LTO plate/with spare tire/with 2 spare key/right side tail light cover small crack/with seat cover/with reverse camera/with warranty booklet/cross member support traces of bending/with jack and incomplete tools/abnormal engine noise/plate light issue/</p> |