

General Information

Date & Time: 23, May, 2026 06:45

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	28,277
Registration No.	NKL9908	Chassis No.	PAHACACA5R6420438
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



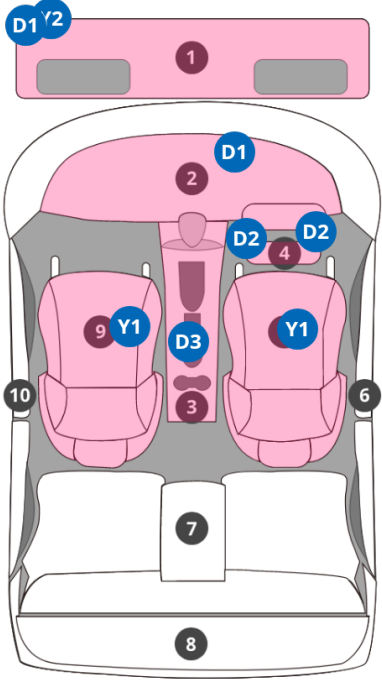
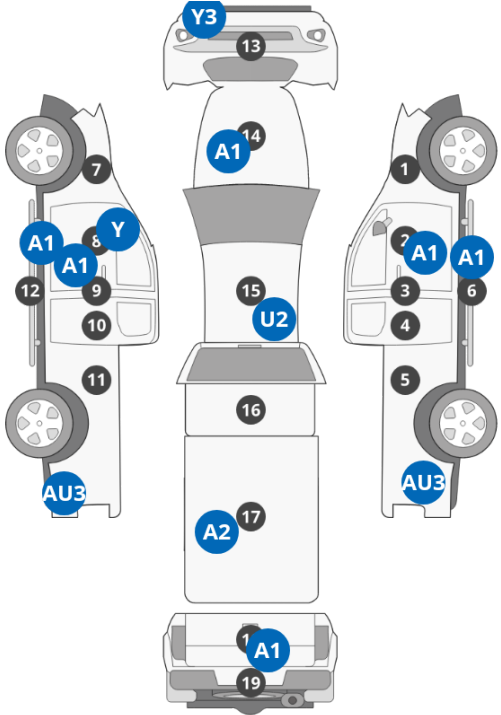
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	93.7	95	95	92
2	Boot Lid	64.5	61	62	70
3	Roof	109.2	113	111	104/109
4	Left Front Fender	95.1	95	98	92
5	Left Front Door	91.8	93	89	94
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	87.4	72	76	114
9	Right Front Fender	98.5	99	102	95
10	Right Front Door	96.4	95	99	96
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	88.6	102	88	76

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / Sunvisor, Sunglass Holder - Loose, Deformed - Minimal / Dashboard - Worked - Minimal / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / Console, Switches, Vents - Loose, Deformed - Medium / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal	Remarks Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Guard Frame - Scratch & Dent - Medium / Rear Gate - Scratch - Minimal / Cargo Bed Floor - Scratch - Small / (L) Guard Frame - Scratch & Dent - Medium / (L) Mirror - Crack - Damaged / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Roof - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with Ito plate/with manual and warranty booklet/with tools and jack/no reverse camera