

General Information

Date & Time: 22, May, 2026 07:43

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	15,324
Registration No.	NKQ5468	Chassis No.	PAHACACA9S6422134
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



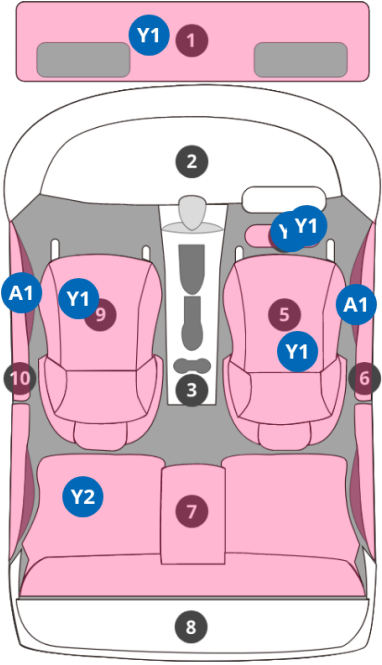
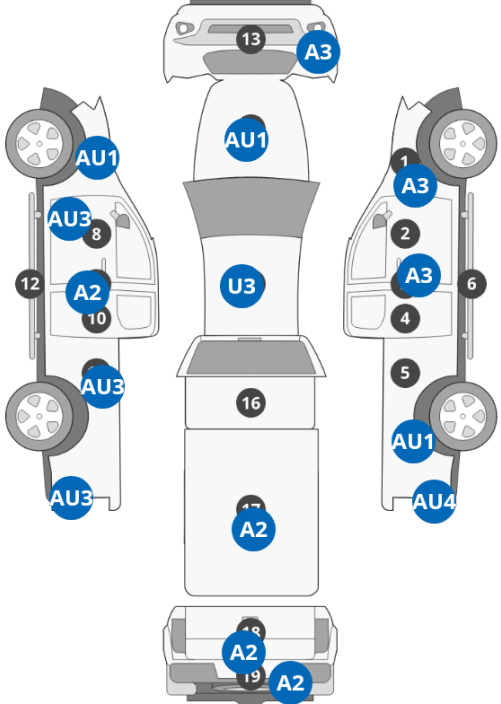
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.8	122	94	108
2	Boot Lid	63.1	67	63	60
3	Roof	123.2	121	131	119/122
4	Left Front Fender	111.6	114	105	116
5	Left Front Door	103.6	103	104	104
6	Center Panel Left	99.8	79	97	124
7	Left Rear Door				
8	Left Back Panel	62.5	59	66	63
9	Right Front Fender	117.3	118	103	131
10	Right Front Door	104.6	106	108	100
11	Center Panel Right	115.6	140	106	101
12	Right Rear Door				
13	Right Back Panel	59.1	58	63	57

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Floor Mat - Grime - Minimal / (R) Front Floor Mat - Grime - Minimal / (L) Front Trim - Cut, Crack - Minimal / (R) Front Trim - Cut, Crack - Minimal / Rear Seat - Grime - Small / Ceiling - Grime - Minimal	Remarks (R) Front Door, Molding - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Side Gate - Scratch & Dent - Medium / (L) Guard Frame - Scratch & Dent - Medium / Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Guard Frame - Scratch & Dent - Large / (R) Side Gate - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch - Medium / Roof - Dent - Medium / Cargo Bed Floor - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate, with spare tire, no tools and jack, no warranty and manual booklet, no spare key, no reverse camera, scratches on taillight and headlight, scratches and dent on exterior.