

General Information

Date & Time: 22, May, 2026 07:44

Make	Toyota	Model	Hilux Tamaraw
YOM	2026	Odo Meter Reading	11,948
Registration No.	NLB1282	Chassis No.	PAHACACA8S6429155
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



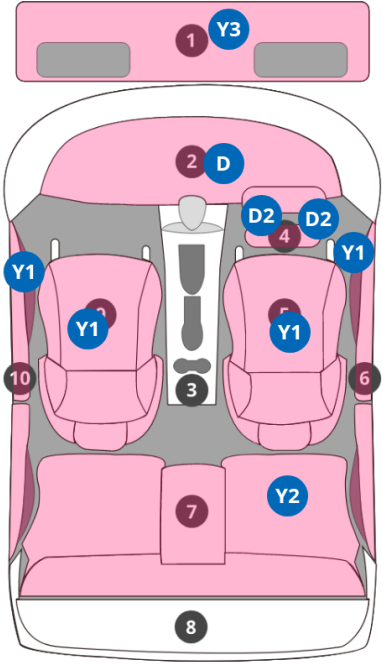
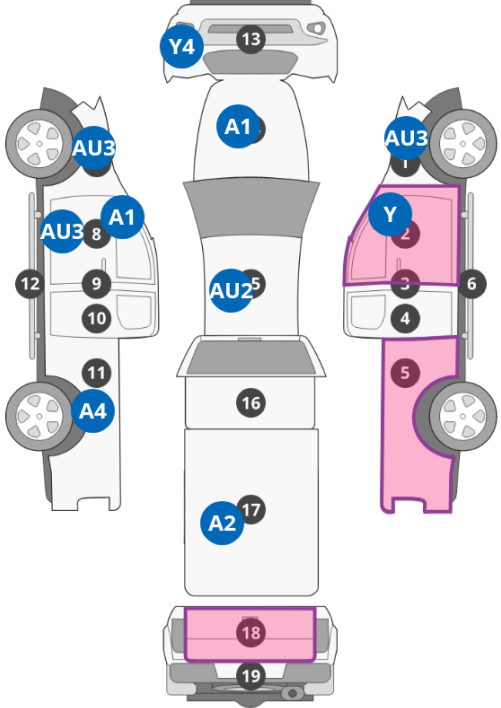
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.6	109	103	96
2	Boot Lid	65.2	64	61	71
3	Roof	116.0	130	117	114/103
4	Left Front Fender	105.0	102	107	106
5	Left Front Door	108.3	106	114	105
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	65.7	70	69	58
9	Right Front Fender	106.3	107	112	100
10	Right Front Door	114.6	106	119	119
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	82.8	54	71	123

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Small / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal	Remarks (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Repair mark - Difference in Color / (R) Guard Frame - Repair mark - Difference in Color / Rear Gate - Repair mark - Difference in Color / (L) Guard Frame - Scratch - Large / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch & Dent - Small / Cargo Bed Floor - Scratch - Small / (R) Mirror - Crack - Damaged / (L) Mirror - Scratch, Peeled - Minimal
Frame Evaluation : A	Functional Evaluation : D
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Shift Shock - Function - Weak

Inspector Notes

with Ito plate/with manual and warranty booklet/with jack no tools/with spare key/no reverse camera/rear tail light damage/with hairline scratches on the body/maintenance warning lamp on/gas cover damage