

General Information

Date & Time: 21, May, 2026 10:01

Make	Nissan	Model	NV350
YOM	2018	Odo Meter Reading	98,594
Registration No.	LAC4076	Chassis No.	JN1TC2E26Z0052244
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



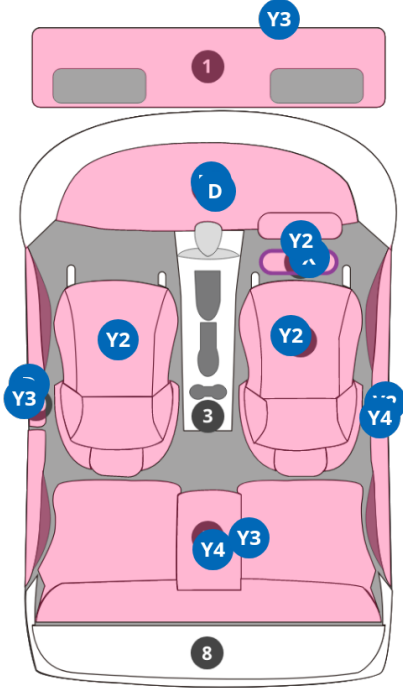
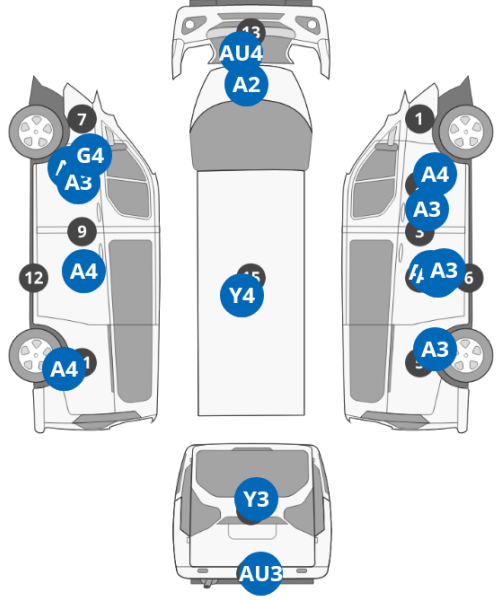
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	90.6	89	91	92
2	Boot Lid	140.6	136	147	139
3	Roof	79.1	83	118	56/60
4	Left Front Fender	75.8	81	74	72
5	Left Front Door	87.6	89	81	93
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	115.4	143	120	83
9	Right Front Fender	71.4	67	70	78
10	Right Front Door	69.2	66	68	74
11	Center Panel Right	85.8	80	87	91
12	Right Rear Door	126.6	127	114	139
13	Right Back Panel	86.0	82	86	90

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Grime - Small / Glove Box - Loose, Deformed - Small / Ceiling - Grime - Medium / (R) Front Trim - Repair Mark - Yes / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Large / Seat belt Other - Grime - Medium / (R) Rear Trim - Grime - Large / (L) Front Seat - Grime - Small / (L) Front Trim - Repair Mark - Yes / (L) Front Trim - Grime - Medium / Dashboard - Repair Mark - Yes	Remarks (L) Rear Fender, Molding - Scratch - Large / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small / (R) Mirror - Scratch - Medium / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Center Panel - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Crack, Gap - Medium / Front Windshield - Damaged - Large / (L) Side Window - Scratch, Stone chip - Large / (L) Step, In-panel, Side Spoiler - Scratch - Large
Frame Evaluation : A	Functional Evaluation : D
Remarks Defects not found	Remarks Power Window (each) - Stuck, Gap - Yes / Power Seat - Issue - Yes / Reverse Camera - N/A - Yes / Brake Pedal - Function - Weak / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
Possible flooded. Windshield damaged. Incomplete tools. Without warranty booklet, seatcover. With Jack, sparetire, LTO plate and 1key.