

General Information

Date & Time: 22, May, 2026 15:52

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	15,558
Registration No.	GBF8211	Chassis No.	MHFAA1BYXR0033390
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Red Mica Metallic		

Body / Panel Condition



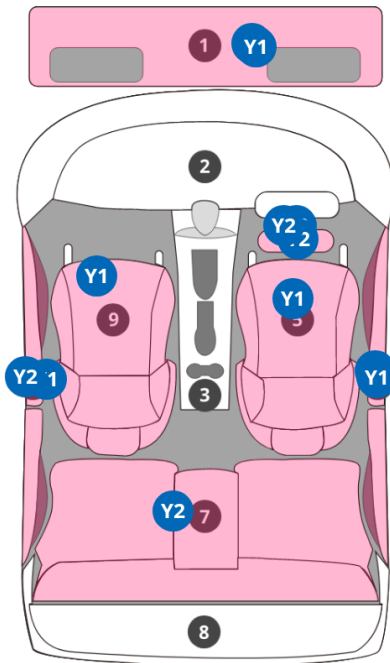
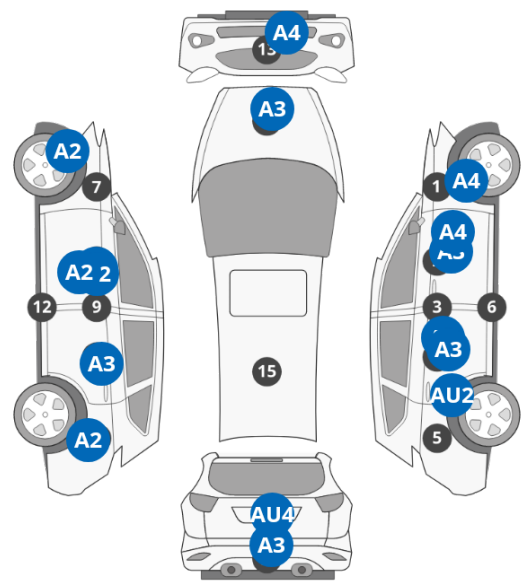
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.0	116	113	125
2	Boot Lid	101.3	97	113	94
3	Roof	121.7	134	125	109/119
4	Left Front Fender	101.1	99	100	104
5	Left Front Door	118.3	116	117	122
6	Center Panel Left				
7	Left Rear Door	113.3	118	111	111
8	Left Back Panel	119.0	132	116	109
9	Right Front Fender	109.6	106	116	107
10	Right Front Door	112.6	114	112	112
11	Center Panel Right				
12	Right Rear Door	109.3	120	106	102
13	Right Back Panel	117.0	110	116	125

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Minimal / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / Overall Interior - Animal Hair - Yes / Ceiling - Grime - Minimal / Rear Seat - Grime - Small / Mat Other - Grime - Small / (R) Rear Trim - Grime - Minimal / (L) Rear Trim - Grime - Small	Remarks (L) Rear Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Medium / (R) Front Fender, Molding - Scratch - Large / (R) Mirror - Scratch - Medium / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
Possible flooded. Incomplete tools. Dent at rear gate trunk. Without seatcover. With warranty booklet, jack, sparetire, LTO plate and 2keys.