

General Information

Date & Time: 23, May, 2026 08:39

Make	Toyota	Model	Vios
YOM	2026	Odo Meter Reading	18,701
Registration No.	GBK4558	Chassis No.	PA1B18F32S4296449
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



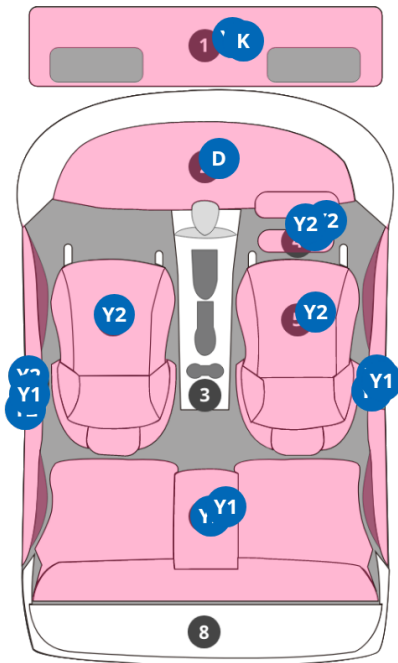
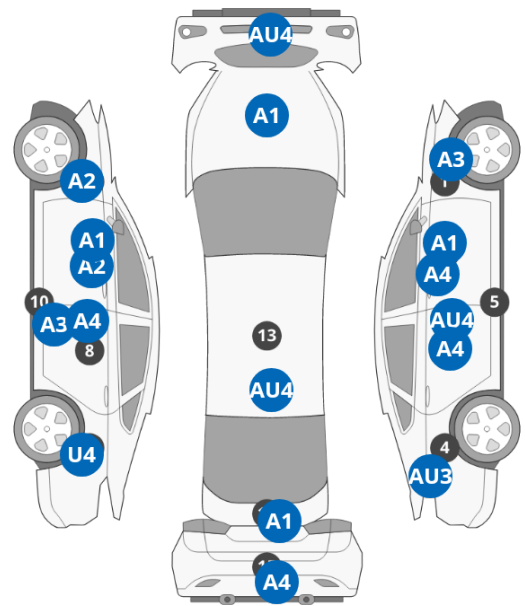
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.6	124	112	126
2	Boot Lid	118.0	120	117	117
3	Roof	103.7	105	105	102/103
4	Left Front Fender	114.3	115	113	115
5	Left Front Door	107.8	114	112	97
6	Center Panel Left				
7	Left Rear Door	107.6	105	107	111
8	Left Back Panel	116.0	115	117	116
9	Right Front Fender	115.6	106	125	116
10	Right Front Door	115.3	116	115	115
11	Center Panel Right				
12	Right Rear Door	112.6	112	113	113
13	Right Back Panel	113.3	111	110	119

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Small / (L) Front Trim - Grime - Small / (L) Rear Trim - Grime - Small / Rear Seat - Grime - Small / (R) Rear Trim - Grime - Minimal / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Small / Mat Other - Grime - Small / Ceiling - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Overall Interior - Animal Hair - Yes / Trim Other - Grime - Minimal / Trim Other - Grime - Minimal / Trim Other - Grime - Minimal	Remarks (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / Roof - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Dent - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch - Large
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

Possible flooded. Left side Taillight Crack, Driver side seatcover missing. Large dent at roof, front bumper and left side rear fender molding. Incomplete tools. Without warranty booklet, LTO plate. With jack, sparetire, seatcover and 1key.