

General Information

Date & Time: 29, Jun, 2026 18:03

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	3,111
Registration No.	FAS9844	Chassis No.	MHKAA1BC2SJ036628
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



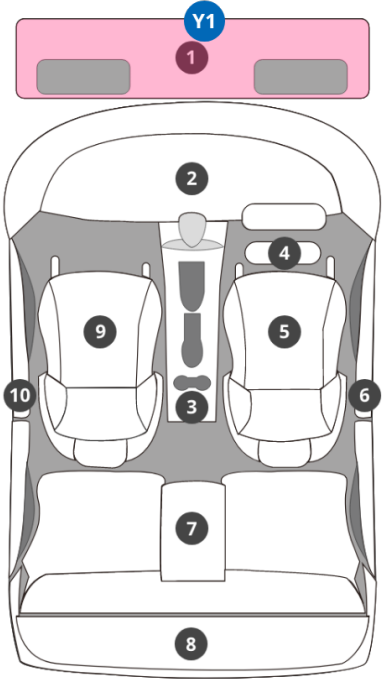
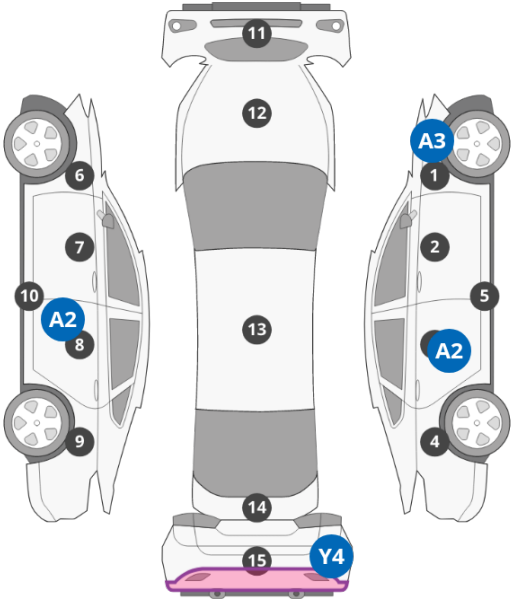
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.7	94	101	92
2	Boot Lid	90.8	95	85	93
3	Roof	84.5	81	79	89/88
4	Left Front Fender	89.1	84	95	88
5	Left Front Door	99.5	103	97	99
6	Center Panel Left				
7	Left Rear Door	92.3	100	88	89
8	Left Back Panel	82.5	81	84	82
9	Right Front Fender	85.3	86	85	86
10	Right Front Door	94.4	94	90	100
11	Center Panel Right				
12	Right Rear Door	94.8	102	89	94
13	Right Back Panel	87.9	88	86	90

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal	Remarks Rear Bumper, Lamps, Panels - Repair mark - Difference in Color / Trunk Hood, Rear Gate - Crack, Gap - Large / (R) Front Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

with Ito plate, no warranty booklet, no jack, no tools, no spare tire, with hairlike scratches in the body.