

General Information

Date & Time: 09, Jun, 2026 11:30

Make	Toyota	Model	Vios
YOM	2019	Odo Meter Reading	53,958
Registration No.	ZAB8473	Chassis No.	PA1B13F33K4095811
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



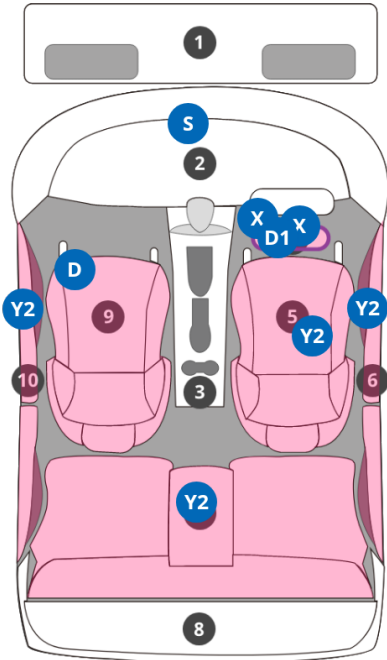
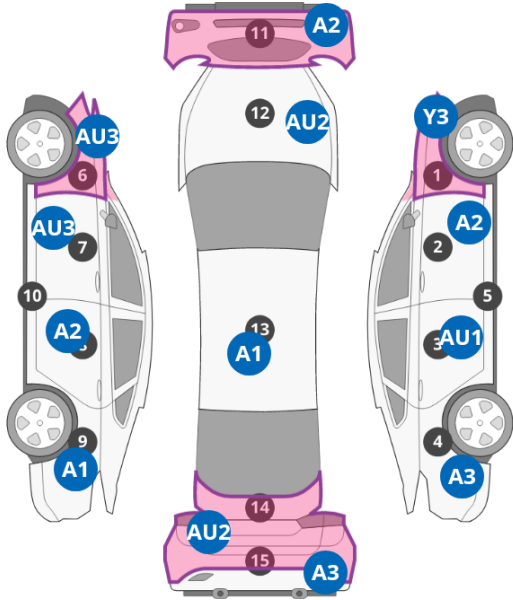
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.8	124	94	85
2	Boot Lid	118.4	122	134	99
3	Roof	81.5	87	81	80/78
4	Left Front Fender	288.6	148	566	152
5	Left Front Door	101.6	99	98	108
6	Center Panel Left				
7	Left Rear Door	106.6	113	104	103
8	Left Back Panel	104.1	114	100	99
9	Right Front Fender	421.0	193	204	866
10	Right Front Door	108.8	91	108	127
11	Center Panel Right				
12	Right Rear Door	91.3	84	97	93
13	Right Back Panel	132.3	130	132	135

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Carpet - Worked - Minimal / (L) Front Seat - Worn - Yes / Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / Overall Interior - Smell - Yes / Overall Interior - Worn as per age - Yes	Remarks (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Rear Fender, Molding - Scratch - Medium / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Crack, Gap - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch - Minimal / Overall Exterior - Worn as per age - Yes
Frame Evaluation : B	Functional Evaluation : B
Remarks Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate/ no warranty booklet / no tools and jack/ no spare tire / no spare key / possible flooded/ power steering issue due to weak battery /taillight cover issue