

General Information

Date & Time: 02, Jun, 2026 14:02

Make	Toyota	Model	Vios
YOM	2016	Odo Meter Reading	90,840
Registration No.	CDJ3004	Chassis No.	PA1BW9F30G2079654
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Orange		

Body / Panel Condition



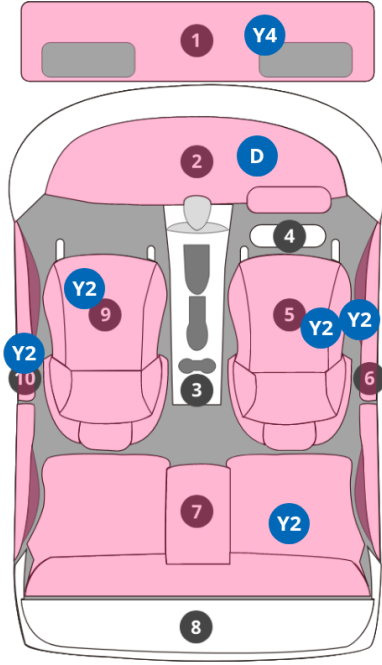
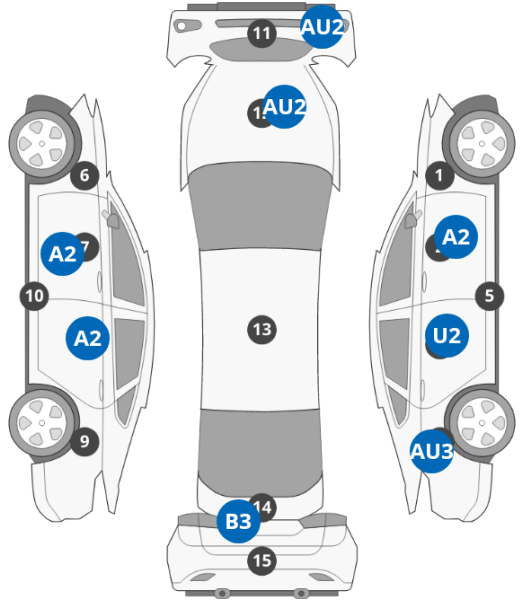
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.3	118	110	133
2	Boot Lid	147.0	125	188	128
3	Roof	198.7	189	190	190/226
4	Left Front Fender	116.0	132	103	113
5	Left Front Door	110.6	108	108	116
6	Center Panel Left				
7	Left Rear Door	138.3	159	131	125
8	Left Back Panel	110.6	116	103	113
9	Right Front Fender	107.5	120	95	108
10	Right Front Door	59.5	15	2	162
11	Center Panel Right				
12	Right Rear Door	121.6	125	118	122
13	Right Back Panel	107.7	123	96	104

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Large / (R) Front Trim - Grime - Small / Rear Seat - Grime - Small / (L) Front Seat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Step - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Roof - Repair Traces - Yes / Trunk Hood, Rear Gate - Modified - Medium / (R) Front Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Head Light, High Beam - Issue - Yes / Seat Belts - Issue - Yes

Inspector Notes

Left an right side mirror not working. rear right passenger seatbelt not working. roof repainted. 3 tire no hub cap. headlight not working. No spare tire. No Jack and tools. with spare key. no seat cover