

General Information

Date & Time: 23, May, 2026 11:05

Make	Toyota	Model	Wigo
YOM	2025	Odo Meter Reading	20,424
Registration No.	GBF7807	Chassis No.	MHKAA1BC1RJ030278
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



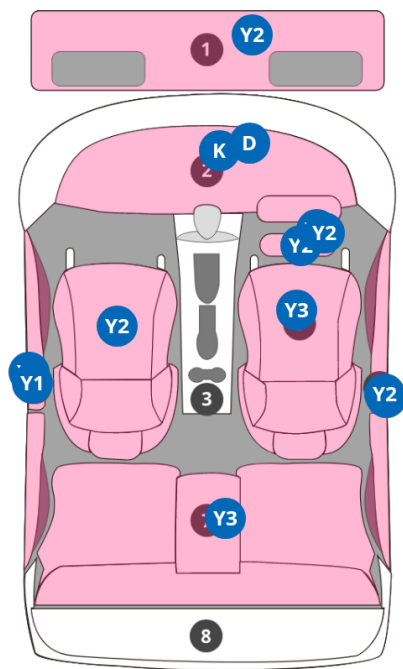
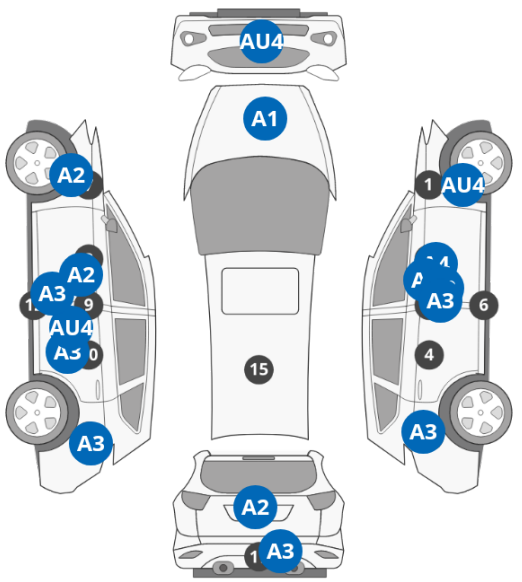
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.3	115	111	111
2	Boot Lid	94.3	95	92	96
3	Roof	87.7	85	85	93/89
4	Left Front Fender	91.2	90	93	91
5	Left Front Door	101.7	96	97	112
6	Center Panel Left				
7	Left Rear Door	95.3	100	95	92
8	Left Back Panel	91.9	91	91	93
9	Right Front Fender	100.6	100	103	99
10	Right Front Door	112.3	112	116	109
11	Center Panel Right				
12	Right Rear Door	109.0	101	111	115
13	Right Back Panel	97.6	100	98	95

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Medium / (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Small / (R) Front Trim - Grime - Small / (R) Rear Trim - Grime - Small / Overall Interior - Animal Hair - Yes / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / Ceiling - Grime - Small / (L) Rear Trim - Grime - Minimal / Rear Seat - Grime - Medium / Mat Other - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes	Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Large / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Battery - Weak - Yes

Inspector Notes

Possible flooded. Incomplete tools. Visible hairline scratches. Warning lamps on Check engine and Maintenance. Without warranty booklet, seatcover. With jack, sparetire, LTO plate and 2keys.