

General Information

Date & Time: 23, May, 2026 15:46

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	10,874
Registration No.	EAL2776	Chassis No.	PA1B18F3XS4290317
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



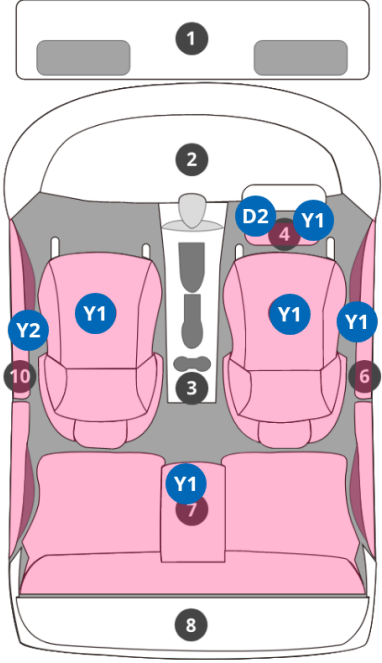
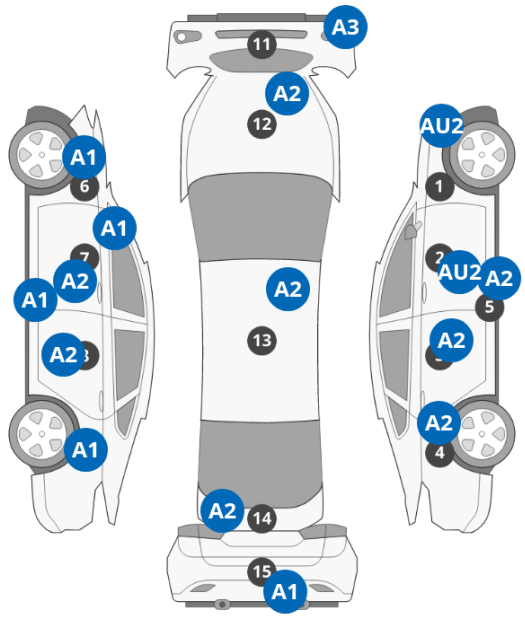
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.0	103	106	115
2	Boot Lid	107.0	103	106	112
3	Roof	97.4	102	96	96/96
4	Left Front Fender	106.8	116	98	107
5	Left Front Door	105.6	105	106	106
6	Center Panel Left				
7	Left Rear Door	106.2	114	106	99
8	Left Back Panel	114.6	120	111	113
9	Right Front Fender	101.8	108	98	100
10	Right Front Door	111.3	116	109	109
11	Center Panel Right				
12	Right Rear Door	107.3	99	102	121
13	Right Back Panel	104.3	102	100	111

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Minimal / (R) Front Trim - Grime - Minimal / (R) Front Floor Mat - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal	Remarks (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

with LTO plate/with warranty booklet/with incomplete tools with jack/with spare tire/hairline scratches on the body