

General Information

Date & Time: 23, May, 2026 15:49

Make	Toyota	Model	Vios
YOM	2026	Odo Meter Reading	21,450
Registration No.	NKU1076	Chassis No.	PA1B18F31S4294563
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



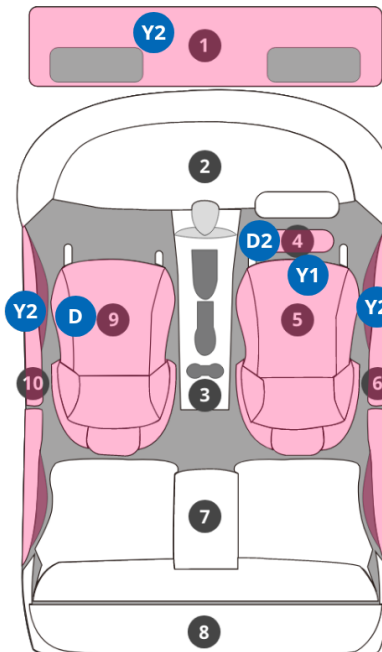
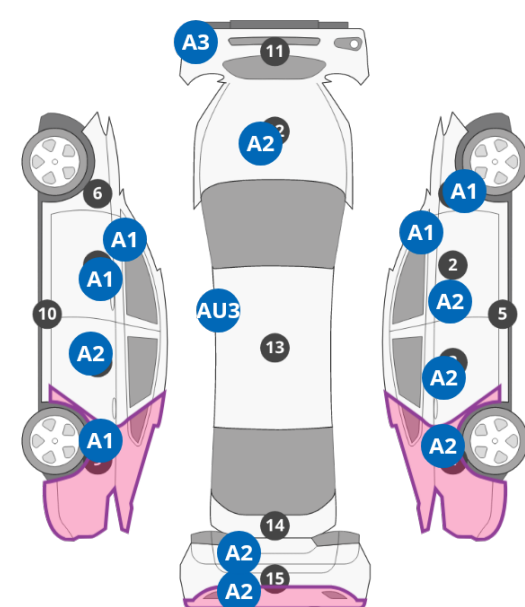
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	128.0	133	125	126
2	Boot Lid	242.6	118	414	196
3	Roof	113.7	120	109	105/121
4	Left Front Fender	108.6	109	107	110
5	Left Front Door	119.6	111	115	133
6	Center Panel Left				
7	Left Rear Door	129.0	131	126	130
8	Left Back Panel	122.3	124	126	117
9	Right Front Fender	119.0	121	121	115
10	Right Front Door	125.6	133	123	121
11	Center Panel Right				
12	Right Rear Door	126.6	120	126	134
13	Right Back Panel	126.0	128	122	128

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Worn - Yes / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Minimal	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Overall Exterior - Faded(Color, Gloss) - Yes / Overall Exterior - Full Re-Paint in same color - Yes / Roof - Scratch & Dent - Medium / (L) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes
Frame Evaluation : B	Functional Evaluation : A
Remarks Rear Side Member & Trunk Room Floor - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Defects not found

Inspector Notes
with warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on tail